


# *jPM Series*

## *Wormgear Units*

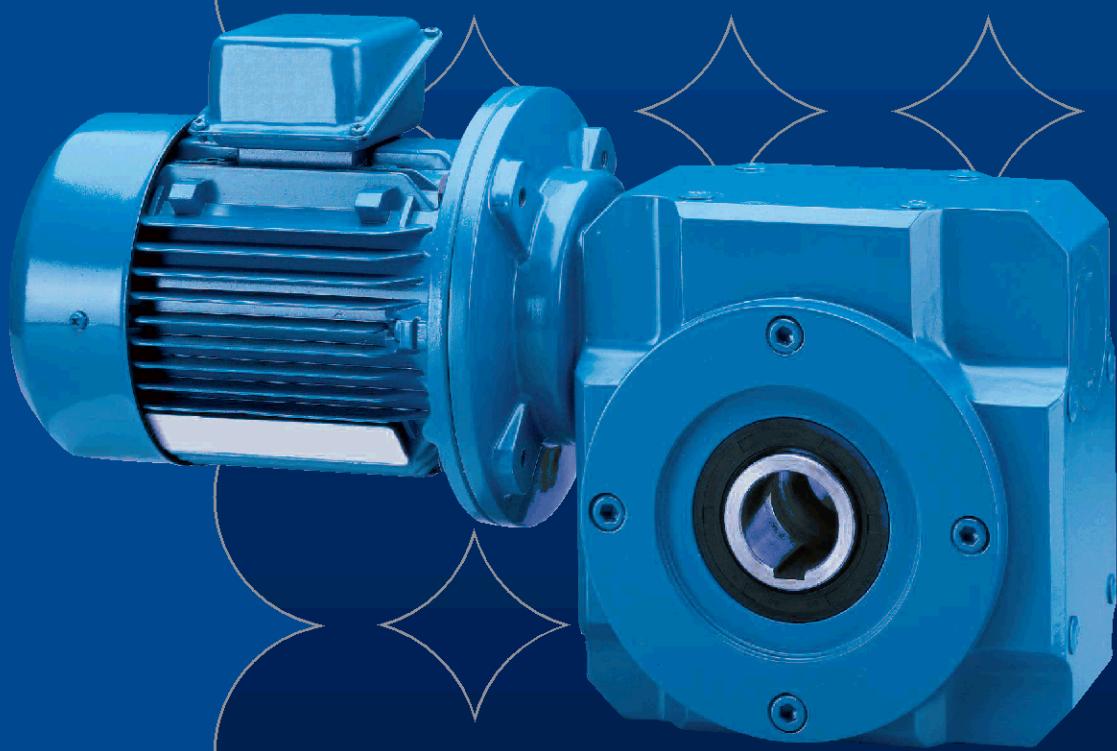


**RENOLD**  
Superior Gear Technology

**jPM Series - Product Features**

One piece output sleeve with electron beam welded bronze worm wheel rim ensure maximum strength under shock load conditions.


Unique Holroyd tooth form for maximum torque capacity and optimum efficiency.

Heavy duty ball & taper roller bearings combining maximum load with long life.

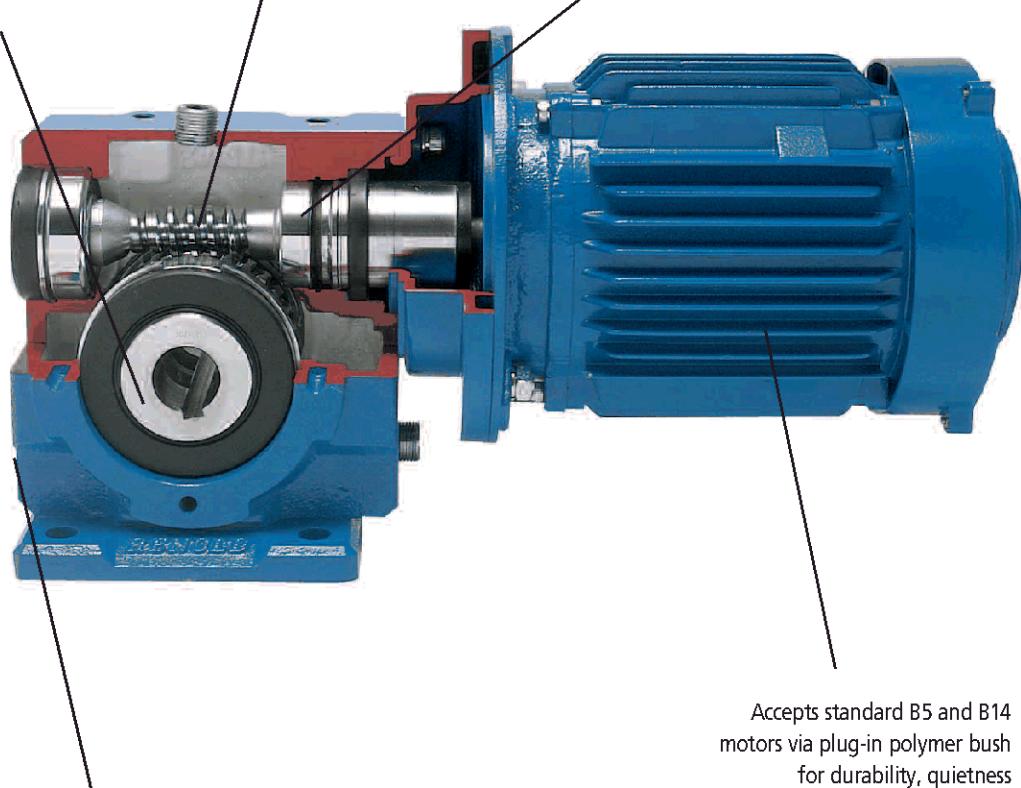

Machined surfaces on all sides of gear case, plus detachable feet and B5 output flange for wide range of mounting options.

Accepts standard B5 and B14 motors via plug-in polymer bush for durability, quietness and strength.

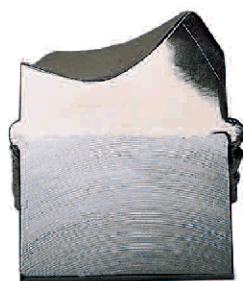

**Section of electron beam welded wormwheel rim and centre showing the fusion of the bronze wormwheel rim onto the cast iron centre.  
This high security fit allows transmission of power under shock load conditions.**

## Contents

	Page No
jPM Unit Features	2
ATEX Approval Details	4
General Specifications	5
Product Options	6
Mounting Positions	7
Unit Designation Code	8
Selection Data - Geared Motor Units	9
Selection Data - Speed Reducers	10
Load Classification by Application	11
Drive Classification	12
Overhung & Thrust Loads	13
Installation and Maintenance	14
Selection Data - Geared Motor Units	15 - 18
Dimensions - Single Reduction Units	19 - 35
Dimensions - Torque Restraints	36
Selection Data - Speed Reducer Units	37 - 48
Renold Worldwide Sales and Service	50 - 51

# ATEX Approval Details

## ATEX Approval

**RENOLD** Gears products for operating in potentially explosive atmospheres.

### General

- **RENOLD** Gears units are classified as ATEX Group II Category 2 equipment, which embodies sufficient safeguards to be suitable for use in potentially explosive atmospheres for normal operation and for operation during an expected malfunction.
- It is essential that there is sufficient lubricant to prevent the gears and bearings running 'dry'. Gear units should be inspected daily for signs of oil leakage, overheating or noisy operation.
- Gear units should be cleaned at regular intervals depending on the operating conditions, to ensure that dust coatings never exceed 5mm. Plastic parts should be wiped clean with a damp cloth.
- Oil leaks should be dealt with as quickly as practical. Compound joint faces and shims should be cleaned and thread-locking sealant should be applied to bolts and plugs prior to re-assembly.


- The temperature of any external surfaces must not exceed the permitted maximum of 135°C (T4).
- Higher temperature class T3 is available dependant on unit mounting, ratio and gear type. For further details consult Renold.
- As a general rule, gear units should be mounted with their feet horizontal. For other mountings, particularly with shaft mounted units, consult **RENOLD** Gears.

**WARNING: IF MOUNTING WITH VERTICAL INPUT OR OUTPUT SHAFTS, THE ATEX CERTIFICATION DOES NOT APPLY.**

### Unit Selection

- The gear unit selection procedures must include an additional reliability factor of 1.25 for mechanical ratings and 1.25 for thermal ratings.

## ATEX Nameplate

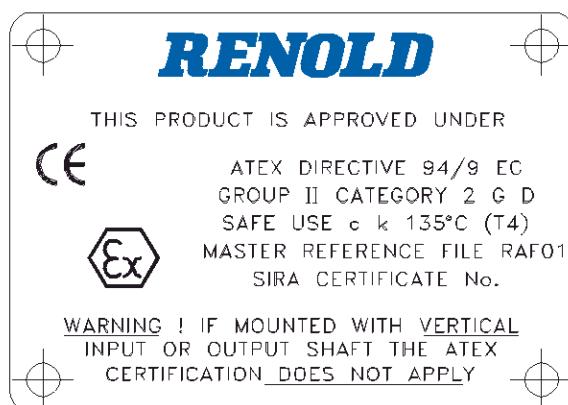

# General Specification

## GEARCASE

The close-grained cast iron gearcase is of one-piece construction to maximize strength and rigidity and to reduce load bearing joints. The internal case style is designed for efficient circulation of lubricant with such a beneficial effect on thermal properties that no cooling fan is necessary. The gearcase contours are smooth and clean to minimize the accumulation of dirt and to facilitate cleaning.

The case is drilled and tapped on three faces to accommodate the bolts for the feet or torque arm bracket. Normally the unit will be delivered with the unused holes blocked with plastic plugs which can be easily removed if required.

## GEARS

The worm is integral with its shaft, and manufactured from alloy steel, case hardened on the threads and ground and polished on the thread profiles. The wormwheel rim is produced from phosphor bronze complying with BS 1400 PB2-C (centrifugally cast) and secured to the steel output sleeve by the electron beam welding process. The Holroyd gear form used in this

range of gearboxes corresponds to British Standard recommendations and, in addition, has an exclusive feature which consists principally of an important modification to the worm thread and wheel tooth which confers additional valuable properties to gear performance. This ensures that our gears will run correctly and transmit true uniform angular velocity even when running under non-uniform load conditions. The modification also gives a tapered oil entry gap between the teeth, which drags the lubricant between the surfaces and results in oil-borne friction only.

## SHAFTS

The shaft extensions and sleeve bores are to metric dimensions and incorporate standard rectangular parallel keyways which conform to BS 4235: Part 1: 1972 and DIN 6885 recommendations.

Where an output shaft extension is required rather than a bored sleeve, this can be supplied from stock and simply "plugged in" and secured with a circlip. The overhung and thrust loads which these shafts will sustain are shown on page 13. Solid construction output shafts are also available.

## BEARINGS

Standard metric bearings to ISO standards are fitted throughout the jPM range of units.

## LUBRICATION

All jPM units are factory-filled with a synthetic lubricant, giving the advantages of low coefficient of friction, extended temperature range and long life. Each unit receives a metered amount suitable for every mounting position shown on page 15. The gears and bearings are positively lubricated by oil from the sump. In certain applications having input speeds below 500 rpm a larger amount of lubricant may be required: in order that this requirement can be identified and met, details of the application and mounting position should be supplied to Renold Gears.

## WEIGHTS

The weights listed below cover the gear units in shaft-mounted form and filled with lubricant.

Unit Ref.	Weight (kg) Single Reduction Unit					
	Speed Reducer	Geared Motors				
		D71	D80	D90S	D90L	D100L
*JPM11	2.9					
JPM17	8.0	15.8	21.4	24.4	25.4	
JPM22	14.5	22.3	27.9	30.9	31.9	41.5
JPM26	20.7	28.5	34.1	37.1	38.1	47.7
JPM30	26.9	34.7	40.3	43.3	44.3	53.9
						61.0

Unit Ref.	Weight (kg) Helical Worm Unit				
	Speed Reducer	Geared Motors			
		D71	D80	D90S	D90L
JPM17	11.6	19.4	25.0	27.8	29.0
JPM22	18.1	25.9	31.5	34.5	35.5
JPM26	24.3	32.1	37.7	40.7	41.7
JPM30	30.5	38.2	43.9	46.9	47.9
					57.5

\*JPM11 geared motor with D63 motor= 6.9kg

\*JPM11 geared motor with D71 motor= 8.3kg

## Options Available

### SPEED REDUCER

This version covers the basic gear unit with the wormshaft having a keyed extension, as shown on page 20.

### MOTOR GEAR UNIT

A motor adaptor is assembled onto the input side of the unit to the frame size specified.

In this form the wormshaft has secured to it a coupling having a bored recess and an axial slot. A keyed plastic bush is fitted to the motor shaft on assembly and as the two are brought together the tongue on the bush is located in the axial drive slot.

Units can be supplied complete with motor or with the adaptor fitted and complete with motor shaft bush to suit our customer's own IEC motor.

### FOOT MOUNTING - TYPE 2

This foot arrangement comprises a single component, dimensional details of which are shown on pages 22 and 23. It can be secured to the gearcase in any of three positions by four socket head screws, the position of foot location being denoted 2.0, 2.1 and 2.2 as shown on page 7.

### OUTPUT ADAPTOR

The circular adaptors which can be attached to the output sides of the gearcase agree to IEC D pattern dimensions and located in a recess machined in the case or wheel cap and secured by socket head screws. They can be fitted to either side.

### FOOT MOUNTING - TYPE 4

These feet are manufactured from steel and are secured by bolts to the holes in the gearcase in the required position; see pages 26 and 27 for dimensional details.

### OUTPUT SHAFT

Where an output shaft extension is required, suitable single or double extension plug-in shafts are available. They can be inserted in the bore, located by the key and secured axially by a circlip. Both the key and circlip are supplied with the shaft.

When assembling the shaft into the sleeve it is advised that an anti-fretting compound be applied. Rocol ASP anti-scuffing paste is a suitable material for this purpose.

Solid output shafts are also available in single and double extension to the same dimensions as the plug-in shafts.

### TORQUE RESTRAINT


When used in the shaft mounting position the unit can be restrained from rotation by attaching to the side of the driven machine by the output flange or by the adjustable torque arm arrangement shown on page 36. Other torque restraint types can be supplied depending on customers preference.

### ADDITIONAL SUPPLY

Any of the above options can be supplied separately or fitted prior to despatch from our works if specified on the order. The various positions and handlings of assembly are shown on page 7.

### HELICAL WORM

A helical first stage reduction is available covering unit sizes 17 to 30, offering ratios from 5:1 to 280:1. The unit is available as a speed reducer or motorised type up to 4 kW capacity. This type of unit has advantages of higher efficiencies and can allow down sizing of unit selections. Further details are available from the Renold Gears sales office.

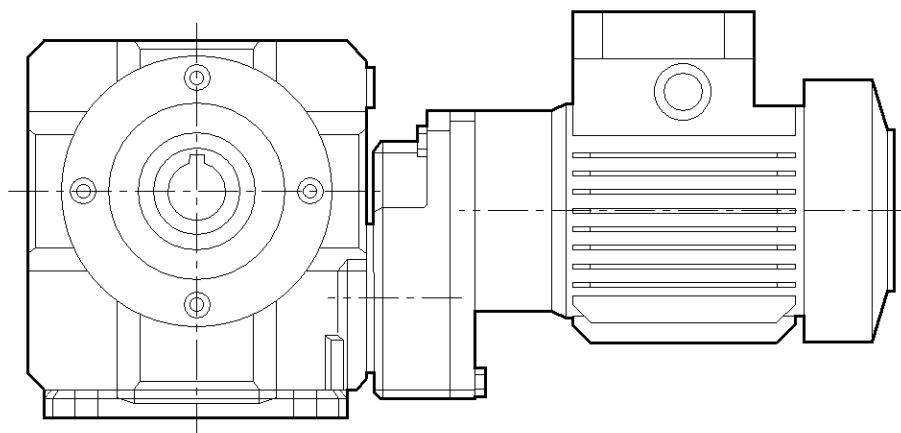





**HELICAL WORM jPM UNIT**

# Mounting Positions


Each unit is filled on assembly with a metered amount of lubricant which is sufficient for each of the mounting positions shown, with the exception of some situations where the input speed is below 500 rpm.

The code numbers indicate the type of foot or flange arrangement relative to the position of the input.


Since the units are sealed they can be placed in any of the positions illustrated without further modification. If a plug-in output shaft is required, and this is to be fitted on supply, the handing arrangement must be specified as indicated.

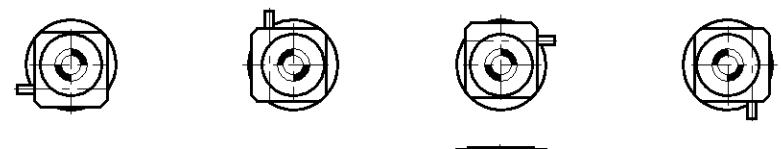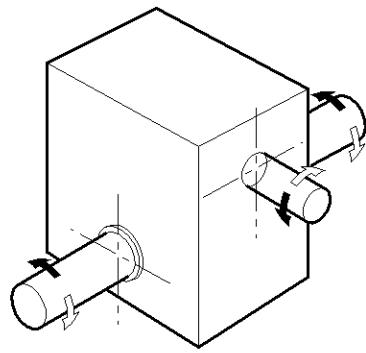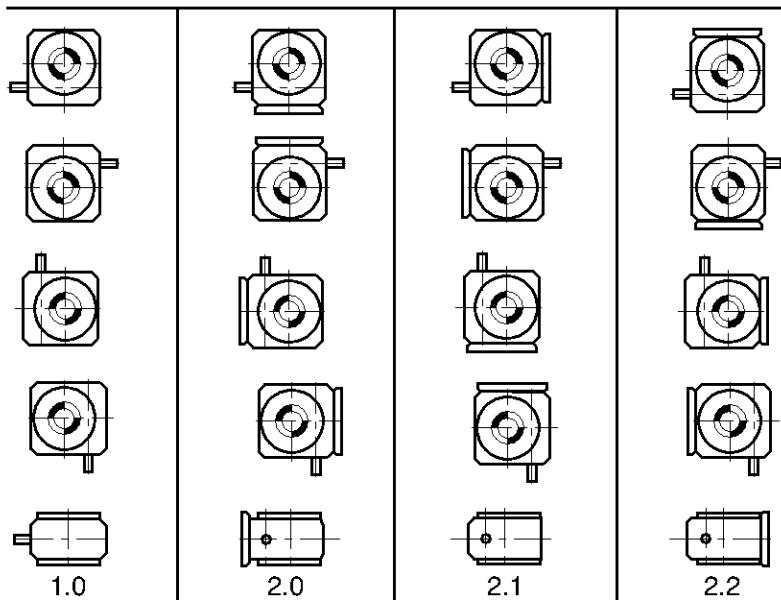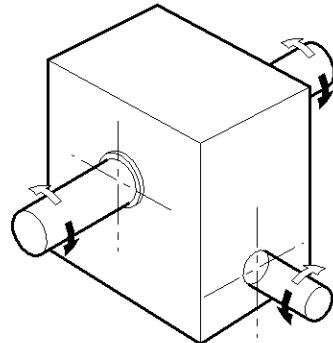

3.0

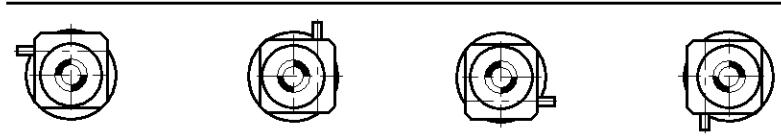

3.1

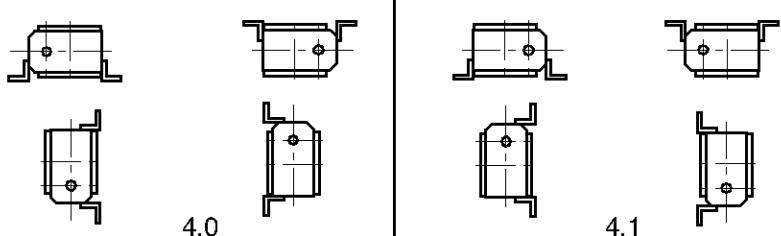


4.0

4.1

The diagrams above illustrate the relative directions of rotation of the input and output shafts. All jPM gear units are reversible.

## HANDINGS

LEFT-L	RIGHT-R	DOUBLE-D

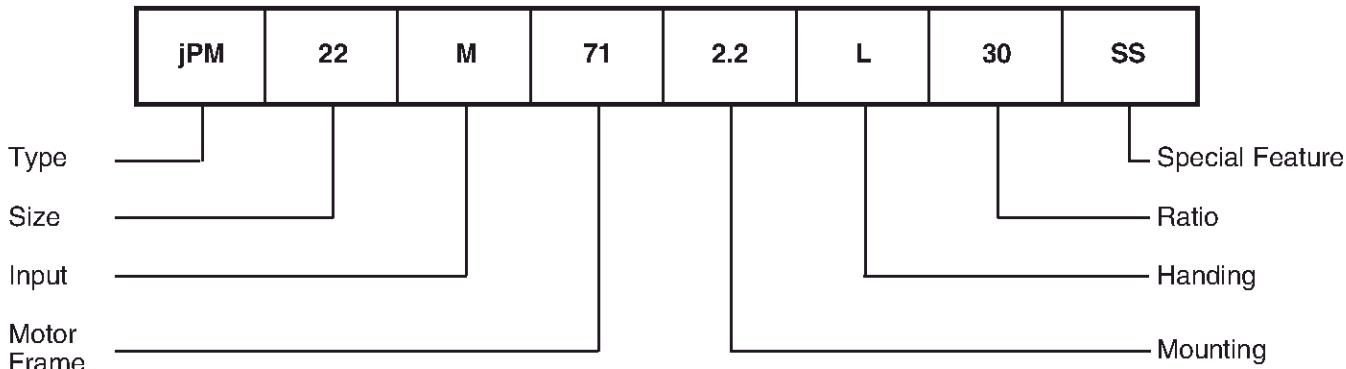**Unit Designation Code****EXAMPLE:**

1. Type  
jPM
2. Size  
Five models: 11, 17, 22, 26, 30
3. Input  
M - Motorised unit with motor supplied  
A - Motorised unit without motor but with motor adaptor  
H - Non-motorised unit with input shaft extension
4. Motor Frame  
Seven Frame sizes:  
63, 71, 80, 90S, 90L, 100, 112
5. Mounting  
Eight Mounting types: see page 7.
6. Handing  
If the unit is to be assembled onto the driven shaft, coding is S. If an output shaft extension is required there are three shaft handing positions: see page 7.  
Use the letter relative to the shaft and handing required.
7. Ratio  
12 Standard ratios: 5, 7.5, 10, 12.5, 15, 20, 25, 30, 40, 50, 60, 70.
8. Special Features  
T - Torque arm assembly  
B - Braked motor. Give details of stop/start frequency, stopping torque on enquiry/order.  
SS - Slow Speed input, i.e. input speed below 500 rpm.  
TR - Torque restraint bracket.

**POWER AND TORQUE RATINGS**

The power and torque ratings published assume a uniform load condition at the speeds stated under ambient temperature conditions between minus 10°C and plus 30°C. If the temperature is likely to exceed 30°C, consult Renold.

**NOTE**

When the duty involves frequent stop/start cycles it may be necessary to check the capacity of the motor for the application. In this situation the inertia of the driven machine will have to be considered.

**SERVICE FACTORS**

Table 1 (page 11) lists a range of applications with an assessment of the nature of the loading; this is then classified as Steady, Medium Impulsive, or Highly Impulsive. The information obtained here can then be applied to table 5 (page 12) for geared motor units, or table 2 (page 11) for reduction gear units, where the hours of operation are also taken into account and the Duty Service Factor  $f_D$  obtained.

The Drive Classification, table 5, facilitates selection of geared motor unit where the gear unit/motor combination is already resolved relative to the duty factor and a straightforward selection can be obtained from the capacities on pages 15 to 18.

If the number of stops and starts exceeds five each hour a Service Factor  $f_S$  must be applied (see table 3 page 4; also NOTE above).

**Example:**

Selection Power=output kW to driven machine  $f_D.f_S.f_T$

# Selection of JPM Units Geared Motor Units

## GEARED MOTOR UNITS

The capacities covering the jPM geared motor units are on pages 15 to 18 where it will be seen that these have already been classified in accordance with the duty requirements based upon the nature of loading and operational hours each day.

The units are listed under the nominal motor power against output speed, with the selection output power and torque included in the block with the respective gear unit size. Variations in efficiency with regard to ratio are therefore taken into account.

The output speeds listed are approximate only, being based upon the nominal gear ratio and a motor speed of 1440 rpm. The actual gear ratios can be found in the capacity charts.

To select a jPM geared motor unit the procedure below should be followed:-

1. Determine the output speed.
  2. Determine the power absorbed by the driven machine:
- Absorbed Power (kW) =  

$$\frac{\text{Absorbed Torque (Nm)} \times \text{Machine Speed (rev/min)}}{9550}$$
3. Determine the load classification from table 5 (page 12) and, using the information obtained together with the number of operating hours each day, derive the Drive Classification from table 5 (page 12).
  4. Select unit from the tables on pages 15 to 18 by class and ensure output power/torque is equal to or in excess of power/torque absorbed by driven machinery.
  5. If unit is subjected to imposed external thrust or overhung loads check the details against the capacities listed on page 13 to confirm such loads are within the capability of the unit.
  6. Note working conditions: clean, dusty, moist, abnormal temperatures etc.

## OVERLOADS

The overload carrying capacity of all jPM units is equivalent to that of the cage-type motors specified for use with them.

## EXAMPLE 1

A jPM shaft-mounted geared motor unit is required to drive a rotary pump at 200 rpm, eight hours per day, and the power requirement is 1.7 kW.

1. Output power is 1.7 kW at 200 rpm given.
2. Rotary pump rated as uniform loading in table 1 and for eight hours per day continuous operation drive requirement is Class 1 in table 5.
3. Reference to nominal power higher than 1.7 kW i.e. 2.2 kW, Drive Classification 1 on page 15 shows that a jPM 22 is available with an output speed of 192 rpm. This is close enough for the duty. The power capacity of the unit is 1.97 kW.

4. The ratio of 7.5/1 can be found in the second column, motor frame size from the table on page 8, and so the coding for the selected unit is:

Type	- jPM
Size	- 22
Input	- M
Motor Frame	- 100
Mounting	- 1.0
Handing	- S
Ratio	- 7.5
Special Features	- None

Which reads: jPM22 M 100 1.0 S 7.5

## EXAMPLE 2

A geared motor unit is required to drive a uniformly loaded bottle conveyor operating for 24 hours each day. The torque required at the output shaft is 200 Nm at 35 rpm. The output shaft projects vertically upwards and is fitted with a 12" pitch circle diameter chainwheel, the unit being mounted on a horizontal surface.

1. Output speed 35 rpm.
2. Power absorbed by driven machine  

$$= \frac{200 \times 35}{9550} = 0.73 \text{ kW}$$
3. Drive classification from table 5 is 2, i.e. uniform load operating in excess of 10 hours per day.
4. Selection table for Drive Classification 2 on page 16 lists nearest output speed of 35 rpm as 36 rpm where we find against torque requirement 200 Nm a size jPM 30 complete with a 1.1 kW motor is rated at 225 Nm.
5. Overhung load  

$$= \frac{9.55 \times 0.73 \times 10^6 \times 1}{6 \times 25.4 \times 36} = 1270 \text{ N}$$

From the chart on page 13 we find that a jPM 30 with an output speed 50 - 25 rpm will support a radial load of 6900N.

The coding for the jPM unit is:

Type	- jPM
Size	- 30
Input	- M
Motor Frame	- 90 i.e. 1.1 kW
Mounting	- 3.1
Handing	- L
Ratio	- 40 i.e. $\frac{1410}{36}$ 40

Special Features - None

Which reads: jPM30 M 90 3.1 L 40.

Confirm that the supply to the motor is 415 volt +/- 5%, 3 phase, 50 Hz.

## Selection of JPM Speed Reducers Units

**GEAR UNITS**

To select a jPM speed reducer unit the following basic information must be known.

1. The power absorbed by the driven machine.
2. Input and output speeds.
3. Characteristics of the drive, e.g. degree of impulsiveness of driven load. See application table on page 11.
4. Duration of service in hours per day.
5. Frequency of stop/start cycles per hour.
6. Disposition and details of external thrust loads or overhung load when the output shaft is fitted.
7. Working conditions: clean, dusty, moist, abnormal temperatures etc.

If the operating conditions are in any way unusual it is advisable to consult our Sales Technical Staff.

From this basic information is derived the gear ratio and selection power to be applied to the Selection Tables.

$$\text{Gear Ratio} = \frac{\text{Input Speed (rpm)}}{\text{Output Speed (rpm)}}$$

The capacities given in pages 37 to 48 are based upon 10 hours per day continuous running with steady, uniform load conditions.

If the load is not steady, or the operational hours per day differ from the nominal rated period, then the actual power is multiplied by a Service Factor to obtain the selection power, and this new figure is then used to determine, from the Selection Tables, the size of unit required.

i.e. Selection power = Actual power x Service Factor (s).

**EXAMPLE 3**

A jPM gear unit is required to drive a machine which is in operation for 24 hours per day under moderate shock load conditions with 20 stop/start cycles per hour. The input speed is 1410 rpm with an output power requirement of 0.8 kW at 55 rpm. The unit is foot mounted with the input shaft horizontal above the output. An output shaft is required projecting to the right when viewed at the input end.

1. Input speed 1410 rpm, output speed 55 rpm and output power 0.8 kW given.

2. Ratio -  $\frac{1410}{55} = 25.6$

Nearest standard is 25/1.

3. The drive classification service factor for 24 hours per day operation under moderate shock load conditions is 1.5 from table 2. The factor for 20 stop/start cycles per hour from table 3 is 1.1.

The selection power is  $0.8 \times 1.5 \times 1.1 = 1.32$  kW.

4. From the capacities listed for 25/1 ratio on page 43 we find that at 1500 rpm a jPM 26 has an output power capacity of 1.48 kW.

The coding therefore is:

Type - jPM  
Size - 26  
Input - H  
Mounting - 2.2  
Handling - L  
Ratio - 25

The code for the above is then jPM 26 H 2.2 L 25.

5. To find the input power required establish the efficiency which  $= \frac{1.38}{1.61} \times 100$

$$= 85.7\%$$

$$\text{Input power} = \frac{0.8 \times 100}{85.7} = 0.93 \text{ kW}$$

# Load Classification By Application

**TABLE 1**

<b>Agitators</b>		Forced draft	*	Rotary kilns	M
Pure liquids	S	Induced draft	M		
Liquids and solids	M	Large, mine etc.	M		
Liquids-variable density	M	Large, industrial	M		
		Light, small diameter	S		
<b>Blowers</b>					
Centrifugal	S				
Lobe	M	<b>Feeders</b>	M		
Vane	S	Apron	M		
		Belt	M		
		Disc	S		
		Reciprocating	H		
		Screw	M		
<b>Brewing and Distilling</b>					
Bottling machinery	S				
Brew kettles-continuous duty	SS				
Cookers-continuous duty	S				
Mash tubs-continuous duty	S				
Scale hopper-frequent starts	M				
<b>Can filling machines</b>	S				
<b>Cane knives (1)</b>	M				
<b>Car dumpers</b>	H				
<b>Car pullers</b>	M				
<b>Clarifiers</b>	S				
<b>Classifiers</b>	M				
<b>Clay working machinery</b>					
Brick press	H				
Briquette machine	H				
Clay working machinery	M				
Pug mill	M				
<b>Compressors</b>					
Centrifugal	S				
Lobe	M				
Reciprocating - multi-cylinder	M				
Reciprocating - single cylinder	H				
<b>Conveyors - uniformly loaded or fed</b>					
Apron	S				
Assembly	SS				
Belt	S				
Bucket	SS				
Chain	S				
Flight	SS				
Live roll	S				
Oven	S				
Reciprocating	H				
Screw	M				
Shaker	H				
<b>Conveyors - heavy duty not uniformly fed</b>					
Apron	M				
Assembly	M				
Belt	M				
Bucket	M				
Chain	M				
Flight	M				
Live roll	*				
Oven	M				
Reciprocating	H				
Screw	M				
Shaker	H				
<b>Crane Drives - not dry dock</b>					
Main hoists	S				
Bridge travel	*				
Trolley travel	*				
<b>Crushers</b>					
Ore	H				
Stone	H				
Sugar (1)	M				
<b>Dredges</b>					
Cable reels	M				
Conveyors	M				
Cutter head drives	H				
Jig drives	H				
Manoeuvring winches	M				
Pumps	M				
Screen drive	H				
Stackers	M				
Utility winches	M				
<b>Dry dock cranes</b>					
Main hoist	(2)				
Auxiliary hoist	(2)				
Boom, luffing	(2)				
Rotating, swing or slew	(3)				
Tracking, drive wheels	(4)				
<b>Elevators</b>					
Bucket - uniform load	S				
Bucket - heavy load	M				
Bucket - continuous	SS				
Centrifugal discharge	S				
Escalators	S				
Freight	M				
Gravity discharge	S				
Man lifts	*				
Passenger	*				
<b>Extruders (plastic)</b>					
Film	S				
Sheet	SS				
Coating	S				
Rods	SS				
Tubing	S				
Blow moulders	M				
Pre-plasticisers	M				
<b>Fans</b>					
Centrifugal	S				
Cooling towers	*				
Induced draft	*				
<b>Forced draft</b>					
Induced draft	M				
Large, mine etc.	M				
Large, industrial	M				
Light, small diameter	S				
<b>Food industry</b>					
Beef slicer	M				
Cereal cooker	S				
Dough mixer	M				
Meat grinder	M				
<b>Generators - not welding</b>	S				
<b>Hammer mills</b>	H				
<b>Hoists</b>					
Heavy duty	H				
Medium duty	M				
Skip hoist	M				
<b>Laundry</b>					
Washers - reversing	M				
Tumblers	M				
<b>Line shafts</b>					
Driving processing equipment	M				
Light	S				
Other line shafts	S				
<b>Lumber industry</b>					
Barkers, hydraulic, mechanical	M				
Burner conveyor	M				
Chain saw and drag saw	H				
Chain transfer	H				
Craneway transfer	H				
De-barking drum	H				
Edger feed	M				
Gang feed	M				
Green chain	M				
Live rolls	H				
Log deck	H				
Log haul-incline	H				
Log haul-well type	H				
Log turning device	H				
Main log conveyor	H				
Off bearing rolls	M				
Planer feed chains	M				
Planer floor chains	M				
Planer tilting hoist	M				
Re-saw merry-go-round conveyor	M				
Roll cases	H				
Slab conveyor	H				
Small waste conveyor-belt	S				
Small waste conveyor-chain	M				
Sorting table	M				
Tipple hoist conveyor	M				
Tipple hoist drive	M				
Transfer conveyors	M				
Transfer rolls	M				
Tray drive	M				
Trimmer feed	M				
Waste conveyor	M				
<b>Machine tools</b>					
Bending roll	M				
Punch press-gear driven	H				
Notching press-belt drive	*				
Plate planers	H				
Tapping machine	H				
Other machine tools	M				
Main drives	M				
Auxiliary drives	S				
<b>Metal mills</b>					
Drawn bench carriage and main drive	M				
Pinch, dryer and scrubber rolls, reversing	*				
Slitters	M				
Table conveyors non-reversing group drives	M				
Individual drives	H				
Reversing	*				
Wire drawing and flattening machine	M				
Wire winding machine	M				
<b>Mills, rotary type</b>					
Ball (1)	M				
Cement kilns (1)	M				
Dryers and coolers (1)	M				
Kilns other than cement	M				
Pebble (1)	M				
Rod, plain & wedge bar (1)	M				
Tumbling barrels	H				
<b>Mixers</b>					
Concrete mixers continuous	M				
Concrete mixers intermittent	M				
Constant density	S				
Variable density	M				
<b>Oil industry</b>					
Chillers	M				
Oil well pumping	*				
Paraffin filter press	M				

**S** = Steady  
**M** = Medium Impulsive  
**H** = Highly Impulsive  
\* = Refer to Renold Gears  
(1) = Select on 24 hours per day service factor only.  
(2) = Use service factor of 1.00 for any duration of service.  
(3) = Use service factor of 1.25 for any duration of service.  
(4) = Use service factor of 1.50 for any duration of service.

**NOTE**

Machinery characteristics and service factors listed in this catalogue are a guide only. Some applications (e.g. constant power) may require special considerations. Consult Renold Gears.

**SERVICE FACTORS****TABLE 2 (SERVICE FACTOR  $f_D$ )**

Prime mover (Drive input)	Driven machinery characteristics			
	Duration Service	Steady load	Medium impulsive	Highly impulsive
	hours/day			
Electric, Air & Hydraulic Motors or Steam Turbine (Steady input)	intermittent - 3hrs/day max	0.90	1.00	1.50
	3 - 10	1.00	1.25	1.75
	over 10	1.25	1.50	2.00
Multi-cylinder I.C. engine (Medium impulsive input)	intermittent - 3hrs/day max	1.00	1.25	1.75
	3 - 10	1.25	1.50	2.00
	over 10	1.50	1.75	2.25
Single-cylinder I.C. engine (Highly impulsive input)	intermittent - 3hrs/day max	1.25	1.50	2.00
	3 - 10	1.50	1.75	2.25
	over 10	1.75	2.00	2.50

**TABLE 3 FACTOR FOR STARTS/HOURS ( $f_S$ )**

Maximum number of starts per hour	5	50	100	300
Starts Factor $f_S$	1.0	1.1	1.15	1.2



## Drive Classifications

TABLE 5: TABLE OF DRIVE CLASSIFICATION-GEARED MOTOR UNITS

Driven machinery characteristics	Duration of service		
	Under 3 hours	3 to 10 hours	Over 10 hours
Steady	1	1	2
Medium impulsive	1	2	3
Highly impulsive	2	3	4

**IMPORTANT**

Units to ATEX approval must be selected with a minimum drive classification of 2

## Overhung and Thrust Loads

Output shafts of worm gear units are frequently fitted with a spur pinion, chain pinion or belt pulley, causing an overhung load to be imposed on the output shaft and bearings. These loads can generally be sustained by the gear unit; however, if the load is greater than the maximum allowable load for the unit, it may be necessary either to select a larger unit or to lessen the effect of the load on the shaft bearings. This can be done in two ways; the pinion can be mounted on a shaft in its own bearings and the shaft coupled to the gear unit; or the wheel shaft may be extended beyond the overhung load and fitted with an outboard bearing. In order to obtain the best possible arrangement for a particular application (where larger overhung loads are anticipated) customers are advised to submit details of the load to our Sales Technical Staff for their consideration.

In the interests of good design, the overhung member should be fitted as close as possible to the gear case in order to minimise the stresses and reduce the deflecting moment on the unit.

The maximum imposed axial thrust and overhung loads (OHL) to which the units can be subjected are given in the table below.

Imposed axial thrust loads can also be minimised by the use of flexible couplings on the input and output shafts.

For drives where both imposed thrust and overhung loads are encountered, it is advisable to consult our Sales Technical Staff.

Where a double extension shaft is fitted, the maximum overhung loads listed apply in full to each shaft extension.

The overhung load may be calculated by the following formula:

resultant overhung load =

$$\frac{9.55 \times P \times 10^6 \times F}{R \times S} \quad (\text{Newtons})$$

Where P = Power absorbed at output shaft (kW)


S = Speed of output shaft in rev/min

R = Pitch circle radius of chain pinion, spur or helical gear, or belt pulley in mm

F = Overhung drive application factor as follows:

Chain pinion	1.00
Spur or helical gear	1.25
Vee pulley	1.50
Flat belt pulley	2.00

The overhung load capacities listed in the table below assume the load is applied mid-way along the output shaft extension, the relevant dimension from the centre line of the unit being as given in the diagram.

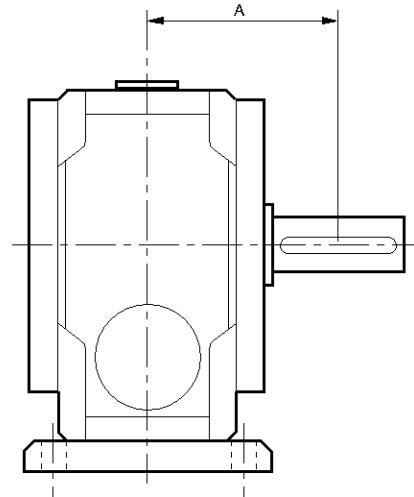

### jPM OVERHUNG LOAD CAPACITIES (N)

OUTPUT RPM	jPM11		jPM17		jPM22		jPM26		jPM30	
	OHL	AXIAL								
300	900	1250	1700	2000	3000	6000	4000	8000	6000	9000
200	950	1400	1750	2500	3200	7000	4200	9000	6200	10000
150	1000	1650	1800	3000	3400	8000	4400	10000	6400	11000
125	1050	1900	1850	3500	3600	9000	4600	11000	6600	12000
100	1100	2200	1900	4000	3800	10000	4700	12000	6700	13000
75	1200	2500	1950	5000	4000	11000	4800	13000	6800	14000
50	1300	2800	2000	6000	4000	12000	4900	14000	6900	15000
25	1350	3200	2050	7000	4000	13000	5000	14000	7000	15000
15	1350	3800	2050	8000	4000	13000	5000	14000	7000	15000
10	1350	4400	2050	9000	4000	13000	5000	14000	7000	15000
5	1350	4800	2050	10000	4000	13000	5000	14000	7000	15000

Unit	Dim A (mm)
jPM11	60
jPM17	75
jPM22	95
jPM26	115
jPM30	140

**INSTALLATION**

Complete instructions on the correct installation and maintenance of jPM units are sent with each unit supplied and additional copies are available on request.

**COUPLINGS AND BEDPLATES**

All couplings should be accurately fitted and shafts accurately aligned. To prevent damage to the bearings, coupling half-bodies should not be hammered onto shafts. Where the plug-in single extension output shaft is fitted the coupling can be assembled onto the shaft prior to securing in the output sleeve. Gear units and other drive components should be rigidly mounted on firm foundations to prevent movement and vibration which may affect the alignment of the shafts. Suitable bedplates can be supplied if required.

**INITIAL RUNNING****First Filling**

Prior to despatch from our works the gearboxes are filled with the correct amount of synthetic lubricant. This is sufficient for all the mounting positions shown on page 7.

**STARTING UP**

All worm gear units have been subjected to a short test before despatch to the customer, but it takes many hours running under full load for the gear to attain its highest efficiency. The gear may if necessary be put to work immediately on full load, but if circumstances permit it is better for the ultimate life of the gears to run under gradually increasing load, attaining the full load after about 20 to 40 hours. Reasonable precautions should, however, be taken to avoid overloads in the early stages of running. Temperature rise on the initial run will be higher than that eventually attained after the gear is fully run-in.

**STORAGE**

All worm gear units stored or left inactive for long periods should be adequately protected, particularly those on exposed sites and/or operating in corrosive or salty atmospheres. Units left inactive for long periods should, ideally, be run at full speed for not less than 10 minutes once each month.

Before a gear unit is returned to service after a long period of inactivity, oil seals should be checked and, if necessary, replaced.

**SPARE PARTS**

Information relating to spare parts is available on request.

**BREATHER / VENTING PLUGS**

Two holes for plugs are machined into each jPM unit as shown in Fig 1,2 and 3. Solid taper plugs are factory fitted into the holes as a breather plug is not normally required.

However, if because of continuous higher speed running or high ambient temperatures a breather is required, one is supplied with each unit for customers to fit.

BREATHER PLUG

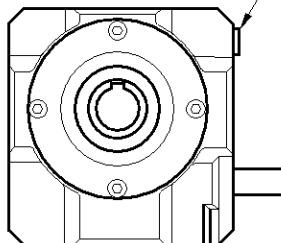


FIG 1

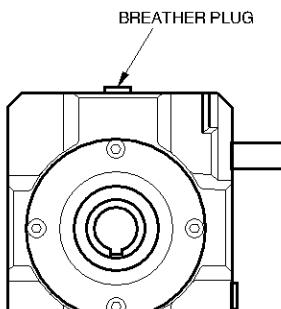


FIG 2

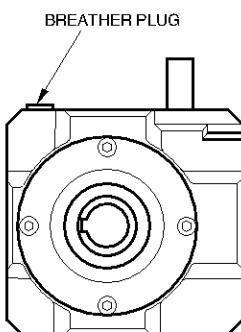


FIG 3

# Geared Motor Units - Drive Classification

Nominal Output Speed revs/min	Nominal gear ratio :1	Motor Power-kW										
		0.12	0.18	0.25	0.37	0.55	0.75	1.1	1.5	2.2	3.0	4.0
288	5	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM17	JPM22	JPM22
		0.11 3.8	0.17 5.7	0.24 7.9	0.35 11.6	0.53 17.5	0.72 24	1.06 35	1.39 46	2.02 67	2.74 91	3.65 121
192	7.5	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM17	JPM22	JPM26
		0.10 5.2	0.16 7.9	0.22 10.9	0.33 16.2	0.48 24	0.66 33	0.99 49	1.25 62	1.97 98	2.69 134	3.62 180
144	10	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26
		0.10 6.8	0.16 10.3	0.22 14.3	0.32 21	0.48 32	0.66 44	0.97 64	1.34 89	1.95 129	2.68 178	3.59 238
115	12.5	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26
		0.10 8.6	0.16 12.9	0.22 17.9	0.29 24	0.48 40	0.67 56	0.90 75	1.34 111	1.87 155	2.66 221	3.60 299
96	15	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30
		0.11 10.5	0.16 15.7	0.22 22	0.33 33	0.49 49	0.67 67	0.94 94	1.29 128	2.03 202	2.77 276	3.55 353
72	20	Size Output power kW torque Nm	JPM11	JPM11	JPM17	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30
		0.10 13.5	0.15 20	0.22 29	0.32 43	0.48 64	0.59 78	0.93 124	1.20 159	1.76 234	2.46 326	
57	25	Size Output power kW torque Nm	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30	JPM30
		0.09 15.4	0.14 23	0.20 33	0.29 49	0.44 73	0.61 103	0.87 146	1.24 208	1.67 280	2.32 388	
48	30	Size Output power kW torque Nm	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30	
		0.09 17.9	0.14 27	0.20 39	0.29 58	0.43 86	0.61 121	0.89 177	1.23 244	1.8 358		
36	40	Size Output power kW torque Nm	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30		
		0.08 22	0.13 35	0.18 49	0.28 73	0.42 112	0.58 153	0.86 227	1.16 307			
28	50	Size Output power kW torque Nm	JPM11	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30			
		0.06 22	0.12 42	0.17 59	0.26 90	0.39 134	0.54 185	0.81 275				
24	60	Size Output power kW torque Nm	JPM11	JPM17	JPM17	JPM22	JPM26	JPM26	JPM30			
		0.05 20	0.12 48	0.17 67	0.26 102	0.37 147	0.51 201	0.72 288				
20	70	Size Output power kW torque Nm	JPM11	JPM17	JPM22	JPM22	JPM26	JPM30				
		0.03 16.6	0.13 53	0.16 77	0.24 114	0.36 174	0.50 239					

**A**  
**IMPORTANT**  
Units to ATEX approval must be selected with a minimum drive classification of 2

Actual output speeds depend upon the full load speed of the motor and the exact gear ratio, and may differ from the nominal speeds listed.

## Geared Motor Units-Drive Classification 2

Nominal Output Speed revs/min	Nominal gear ratio :1	Motor Power-kW											
		0.12	0.18	0.25	0.37	0.55	0.75	1.1	1.5	2.2	3.0	4.0	
288	5	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM22	JPM26
			0.11 3.8	0.17 5.7	0.24 7.9	0.35 11.6	0.53 17.5	0.72 24	1.06 35	1.36 45	2.02 67	2.74 91	3.89 129
192	7.5	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30
			0.10 5.2	0.16 7.9	0.22 10.9	0.33 16.2	0.48 24	0.66 33	0.99 49	1.35 67	1.97 98	2.69 134	3.62 180
144	10	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30	
			0.10 6.8	0.16 10.3	0.22 14.3	0.32 21	0.48 32	0.66 44	0.98 65	1.33 88	1.96 130	2.70 179	
115	12.5	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30	
			0.10 8.6	0.16 12.9	0.22 17.9	0.33 27	0.48 40	0.66 55	0.99 82	1.34 111	1.97 164	2.70 224	
96	15	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM30	JPM30	
			0.11 10.5	0.16 15.7	0.22 22	0.33 33	0.49 49	0.67 67	0.94 94	1.29 128	2.03 202	2.77 276	
72	20	Size Output power kW torque Nm	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30		
			0.10 13.5	0.15 20	0.22 29	0.32 43	0.48 64	0.63 84	0.98 130	1.33 177	1.98 262		
57	25	Size Output power kW torque Nm	JPM11	JPM11	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30	JPM30		
			0.09 15.4	0.14 23	0.20 33	0.29 48	0.45 76	0.61 103	0.91 153	1.14 191	1.83 307		
48	30	Size Output power kW torque Nm	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30	JPM30		
			0.09 17.9	0.14 28	0.20 39	0.33 66	0.44 88	0.61 121	0.89 178	1.23 244	1.80 358		
36	40	Size Output power kW torque Nm	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30				
			0.09 23	0.13 35	0.18 49	0.28 75	0.42 112	0.58 155	0.85 225				
28	50	Size Output power kW torque Nm	JPM17	JPM17	JPM17	JPM22	JPM26	JPM26	JPM30				
			0.08 28	0.12 42	0.17 59	0.26 90	0.40 136	0.54 185	0.81 275				
24	60	Size Output power kW torque Nm	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30					
			0.08 32	0.12 48	0.17 69	0.26 102	0.39 155	0.55 217					
20	70	Size Output power kW torque Nm	JPM17	JPM22	JPM22	JPM26	JPM30						
			0.08 36	0.12 55	0.16 77	0.25 117	0.37 175						



**IMPORTANT**

Units to ATEX approval must be selected with a minimum drive classification of 2

# Geared Motor Units - Drive Classification 3

Nominal Output Speed revs/min	Nominal gear ratio :1	Motor Power-kW											
		0.12	0.18	0.25	0.37	0.55	0.75	1.1	1.5	2.2	3.0	4.0	
288	5	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM22	JPM30	
			0.11 3.8	0.17 5.7	0.24 7.9	0.36 12.0	0.53 17.5	0.72 24	1.00 33	1.36 45	2.02 67	2.71 90	3.89 129
192	7.5	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30	JPM30
			0.10 5.2	0.16 7.9	0.22 10.9	0.32 16.0	0.48 24	0.66 33	0.99 49	1.35 67	1.97 98	2.71 135	3.62 180
144	10	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30	
			0.10 6.8	0.16 10.3	0.22 14.3	0.32 21	0.48 32	0.66 44	0.98 65	1.33 88	1.96 130	2.70 179	
115	12.5	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30	
			0.10 8.6	0.16 12.9	0.22 17.9	0.33 27	0.48 40	0.66 55	0.99 82	1.34 111	1.97 164	2.70 224	
96	15	Size Output power kW torque Nm	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30		
			0.11 10.5	0.16 15.7	0.22 22	0.33 33	0.49 49	0.64 64	0.94 94	1.39 138	2.03 202		
72	20	Size Output power kW torque Nm	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30			
			0.10 13.5	0.16 21	0.22 29	0.32 43	0.47 62	0.63 84	0.98 130	1.35 179			
57	25	Size Output power kW torque Nm	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30			
			0.09 15.4	0.14 23	0.20 33	0.29 49	0.45 76	0.61 103	0.91 153	1.25 209			
48	30	Size Output power kW torque Nm	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30			
			0.09 17.9	0.14 28	0.20 39	0.29 58	0.44 88	0.61 121	0.90 179	1.23 244			
36	40	Size Output power kW torque Nm	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30				
			0.09 23	0.13 35	0.18 49	0.28 75	0.42 112	0.58 155	0.85 225				
28	50	Size Output power kW torque Nm	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30					
			0.08 28	0.12 42	0.18 61	0.26 90	0.40 136	0.55 188					
24	60	Size Output power kW torque Nm	JPM17	JPM17	JPM22	JPM26	JPM30						
			0.08 32	0.12 48	0.17 69	0.26 104	0.40 159						
20	70	Size Output power kW torque Nm	JPM17	JPM22	JPM22	JPM26	JPM30						
			0.08 36	0.12 55	0.16 77	0.25 117	0.37 175						



## IMPORTANT

Units to ATEX approval must be selected with a minimum drive classification of 2

Actual output speeds depend upon the full load speed of the motor and the exact gear ratio, and may differ from the nominal speeds listed.

# Geared Motor Units-Drive Classification 4


Nominal Output Speed revs/min	Nominal gear ratio :1	Motor Power-kW										
		0.12	0.18	0.25	0.37	0.55	0.75	1.1	1.5	2.2	3.0	4.0
288	5	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM22	JPM30
			0.11 3.8	0.17 5.7	0.24 7.9	0.36 12.0	0.53 17.5	0.72 24	1.00 33	1.36 45	2.02 67	2.93 97
192	7.5	Size Output power kW torque Nm	JPM11	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM26	JPM26	JPM30
			0.10 5.2	0.16 7.9	0.22 10.9	0.32 16	0.48 24	0.66 33	0.99 49	1.35 67	1.97 98	2.71 135
144	10	Size Output power kW torque Nm	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30	
			0.10 6.8	0.16 10.3	0.21 14.0	0.33 22	0.48 32	0.66 44	0.98 65	1.34 89	1.98 131	
115	12.5	Size Output power kW torque Nm	JPM11	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30	
			0.10 8.6	0.16 12.9	0.22 18.0	0.33 27	0.48 40	0.67 56	0.99 82	1.35 112	1.97 164	
96	15	Size Output power kW torque Nm	JPM11	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM26		
			0.11 10.5	0.16 16.0	0.22 22	0.33 33	0.47 47	0.64 64	0.99 98	1.39 138		
72	20	Size Output power kW torque Nm	JPM17	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30		
			0.10 14.0	0.16 21	0.22 29	0.32 43	0.47 62	0.63 84	0.98 130	1.35 179		
57	25	Size Output power kW torque Nm	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30	JPM30		
			0.10 16.0	0.14 23	0.20 33	0.30 51	0.45 76	0.62 104	0.92 154	1.25 209		
48	30	Size Output power kW torque Nm	JPM17	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30			
			0.10 19.0	0.14 28	0.20 39	0.30 59	0.44 88	0.58 115	0.90 179			
36	40	Size Output power kW torque Nm	JPM17	JPM17	JPM22	JPM22	JPM26	JPM30				
			0.09 23	0.13 35	0.19 51	0.28 75	0.43 114	0.58 154				
28	50	Size Output power kW torque Nm	JPM17	JPM22	JPM22	JPM26	JPM30					
			0.08 28	0.13 44	0.18 61	0.27 91	0.40 137					
24	60	Size Output power kW torque Nm	JPM17	JPM22	JPM22	JPM26	JPM30					
			0.08 32	0.13 50	0.17 69	0.26 104	0.40 159					
20	70	Size Output power kW torque Nm	JPM22	JPM22	JPM26	JPM30						
			0.08 37	0.12 55	0.17 79	0.25 118						



**IMPORTANT**  
Units to ATEX approval must be selected with a minimum drive classification of 2

Actual output speeds depend upon the full load speed of the motor and the exact gear ratio, and may differ from the nominal speeds listed.

# jPM11 Geared Motor Unit - Dimensions (mm)

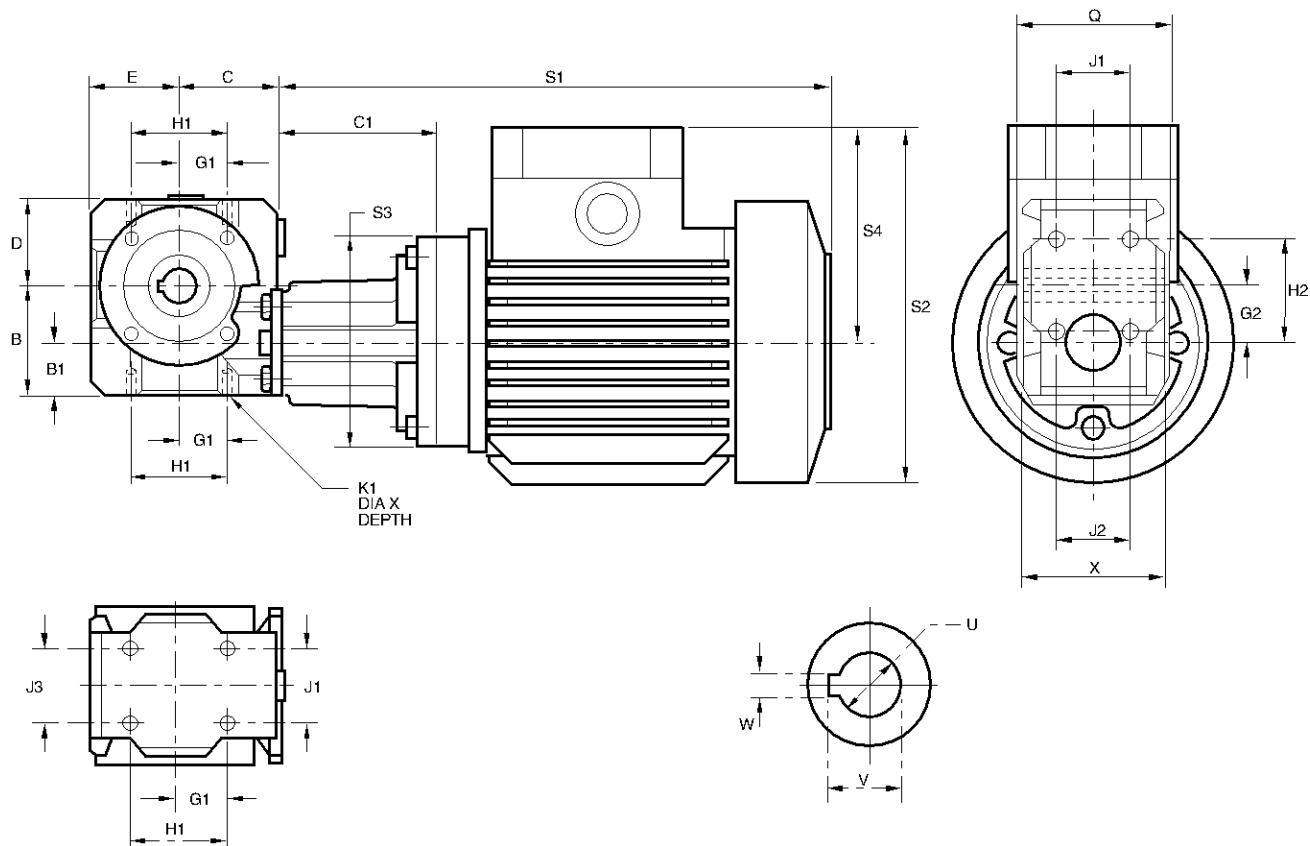


B	B1	C	D	E
55	26.43	52	42	42

G1	H1	K1	Q	J1	G2	H2	J2	X	J3	U	V	W
22.5	45	M6x11	78	37	22.5	45	37	72	37	16.016 16.034	18.4 18.3	5.015 4.985

C1	S1	S2	S3	S4
79	276	140	105	106

## jPM Speed Reducers - Dimensions (mm)

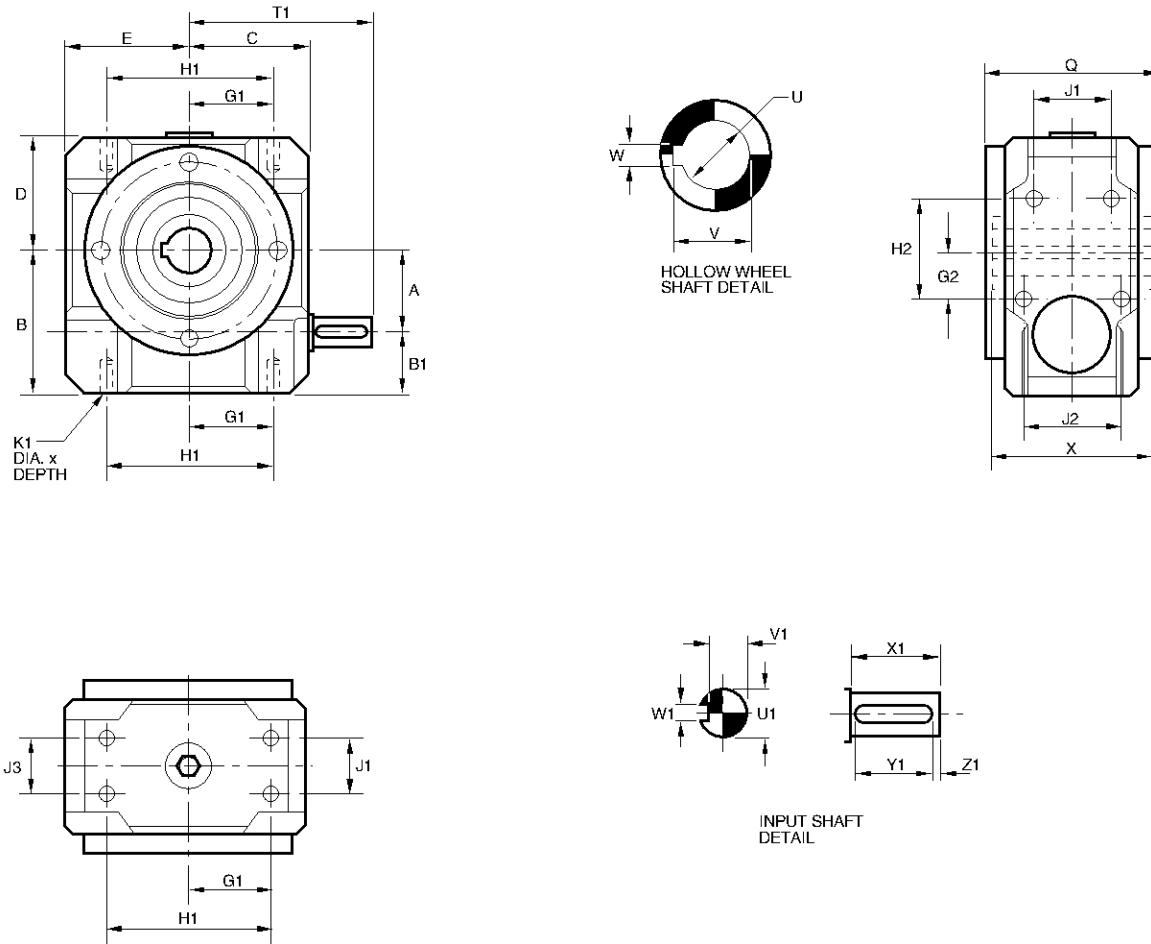


### SHAFT MOUNTING

Unit Ref.	A	B	B1	C	D	E	Q	G1	H1	J1	K1	G2	H2
JPM11	28.57	55	26.43	52	42	42	78	22.5	45	37	M6x11	22.5	45
JPM17	44.45	85	40.55	78	60	67	98	45.5	69.5	43	M10x17	24	69.5
JPM22	57.15	105	47.85	90	80	90	126	57.5	115	45	M10x17	33	90.5
JPM26	66.67	117	50.33	97	92	102	140	43.5	87	72	M12x20	43.5	87
JPM30	76.2	135	58.8	105	100	120	156	51	102	85	M12x22	51	102

Unit Ref.	J2	J3	T1	U1	V1	W1	X1	Y1	Z1	U	V	W	X
JPM11	37	37	84	12.008 11.997	9.5 9.4	3.988 3.958	30	25	2.5	16.016 16.034	18.4 18.3	5.015 4.985	72
JPM17	57	57	120	16.009 15.996	13.0 12.9	4.988 4.958	40	36	2	24.020 24.041	27.5 27.3	8.018 7.982	92
JPM22	55	45	132	19.009 18.996	15.5 15.4	5.988 5.958	40	36	2	30.020 30.041	33.5 33.3	8.018 7.982	118
JPM26	72	72	149	24.009 23.996	20.0 19.8	7.985 7.949	50	40	5	38.025 38.050	41.5 41.3	10.018 9.982	132
JPM30	85	85	157	24.009 23.996	20.0 19.8	7.985 7.949	50	40	5	45.025 45.050	49.0 48.8	14.021 13.979	148

## jPM Geared Motors - Dimensions (mm)

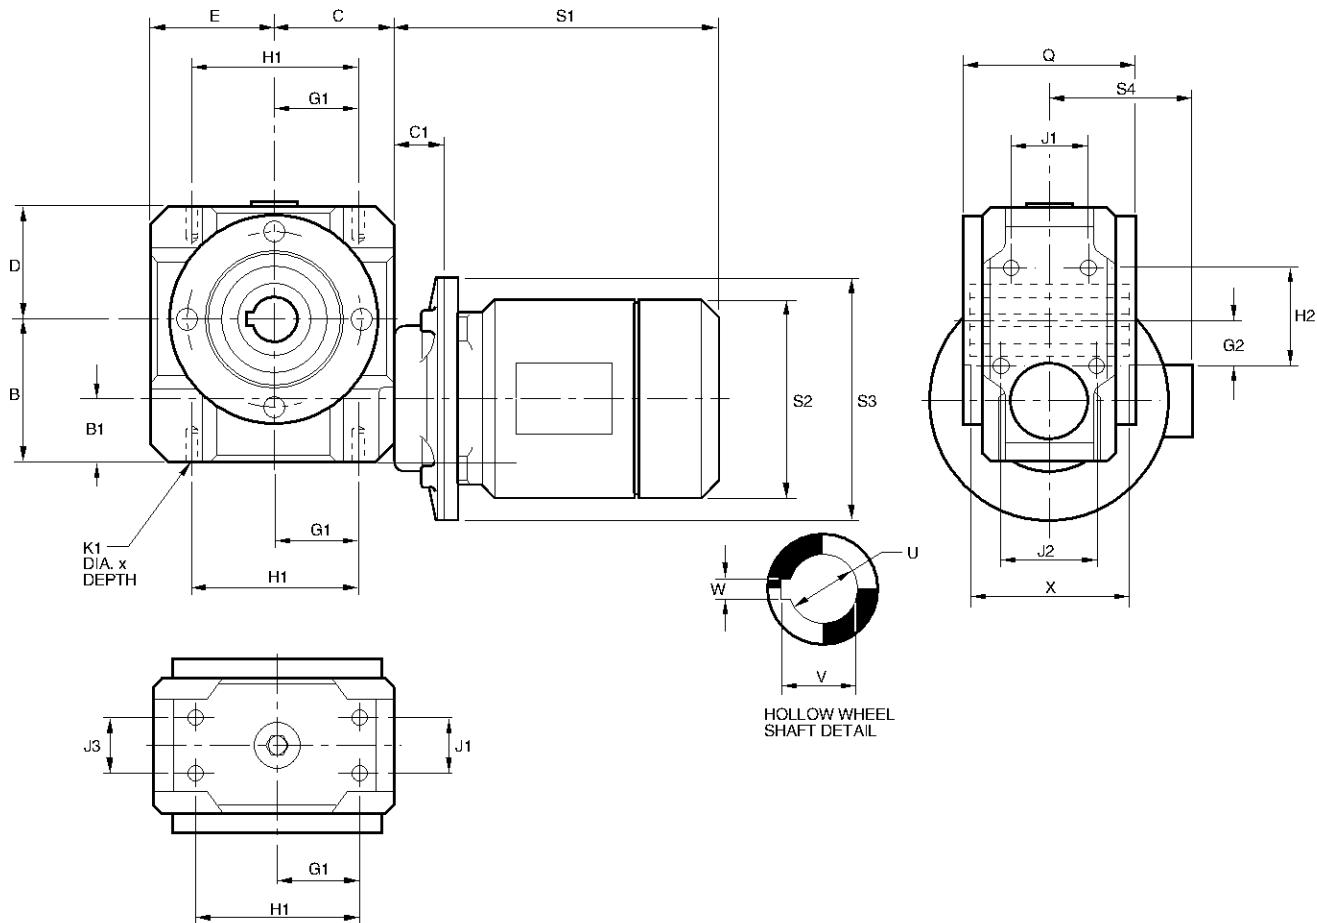

## SHAFT MOUNTING


Unit Ref.	DIM	D71M	D80M	D90S	D90L	D100L	D112M
JPM17	C1	34	44	44	44	54	54
JPM22	S1*	231	269	277	302	344	377
JPM26	S2*	140	157	180	180	200	211
JPM30	S3* D Flange	160	200	200	200	250	250
	S3* C Face	105	120	140	140	160	160
	S4*	106	113	120	120	136	146

\*jPM11 MOTOR DIMENSIONS SEE PAGE 27

Unit Ref.	B	B1	C	D	E
JPM11	SEE PAGE 19				
JPM17	85	40.55	78	60	67
JPM22	105	47.85	90	80	90
JPM26	117	50.33	97	92	102
JPM30	135	58.8	105	100	120

Unit Ref.	G1	H1	K1	Q	J1	G2	H2	J2	X	J3	U	V	W
JPM11	SEE PAGE 19												
JPM17	45.5	69.5	M10x17	98	43	24	69.5	57	92	57	24.020 24.041	27.5 27.3	8.018 7.982
JPM22	57.5	115	M10x17	126	45	33	90.5	55	118	45	30.020 30.041	33.5 33.3	8.018 7.982
JPM26	43.5	87	M12x20	140	72	43.5	87	72	132	72	38.025 38.050	41.5 41.3	10.018 9.982
JPM30	51	102	M12x22	156	85	51	102	85	148	85	45.025 45.050	49.0 48.8	14.021 13.979

## jPM Speed Reducers - Dimensions (mm)

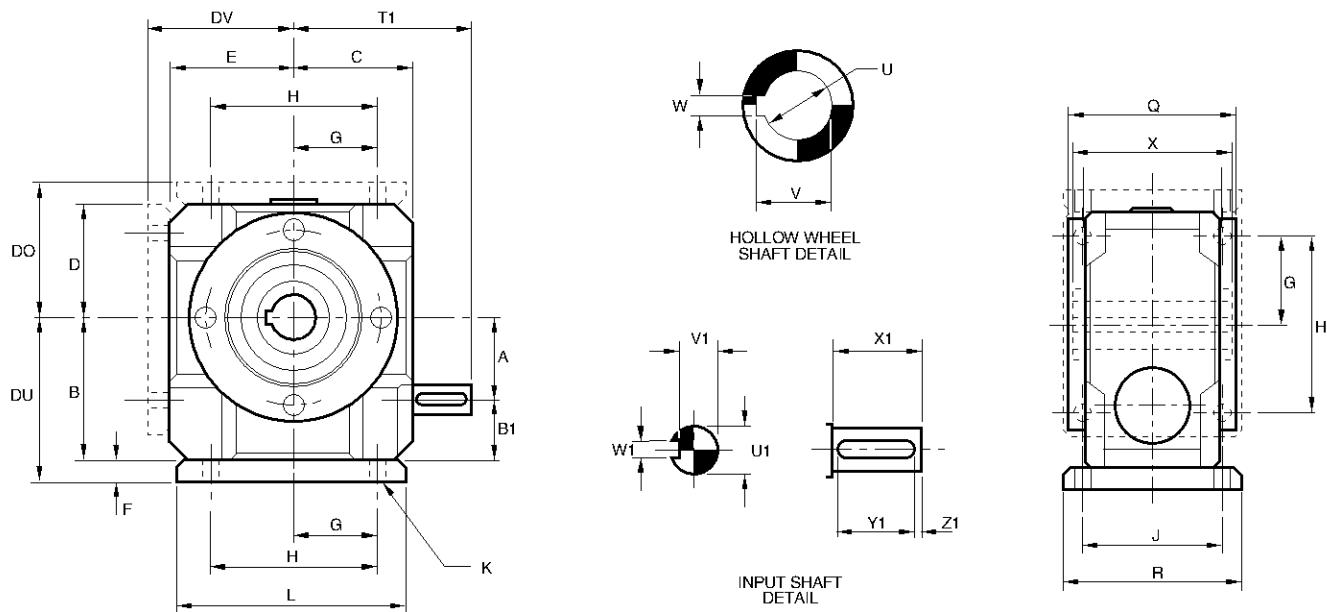


### FOOT MOUNTING-TYPE 2

Unit Ref.	A	B	B1	C	D	E	Q	DO	DU	DV	F	G	H
JPM11	28.57	55	26.43	52	42	42	78	50	63	50	8	35	70
JPM17	44.45	85	40.55	78	60	67	98	73	98	80	13	47.5	95
JPM22	57.15	105	47.85	90	80	90	126	95	120	105	15	57.5	115
JPM26	66.67	117	50.33	97	92	102	140	110	135	120	18	72.5	145
JPM30	76.2	135	58.8	105	100	120	156	120	155	140	20	80	160

Unit Ref.	J	K	L	R	U	V	W	X
JPM11	75	7	84	89	16.016 16.034	18.4 18.3	5.015 4.985	72
JPM17	95	12	128	125	24.020 24.041	27.5 27.3	8.018 7.982	92
JPM22	100	12	160	135	30.020 30.041	33.5 33.3	8.018 7.982	118
JPM26	115	14.5	184	150	38.025 38.050	41.5 41.3	10.018 9.982	132
JPM30	130	14.5	195	165	45.025 45.050	49.0 48.8	14.021 13.979	148

Unit Ref.	T1	U1	V1	W1	X1	Y1	Z1
JPM11	84	12.006 11.997	9.5 9.4	3.988 3.988	30	25	2.5
JPM17	120	16.009 15.996	13.0 12.9	4.988 4.988	40	36	2
JPM22	132	19.009 18.996	15.5 15.4	5.988 5.988	40	36	2
JPM26	149	24.002 23.996	20.0 19.8	7.985 7.949	50	40	5
JPM30	157	24.009 23.996	20.0 19.8	7.985 7.949	50	40	5

# jPM Geared Motors - Dimensions (mm)

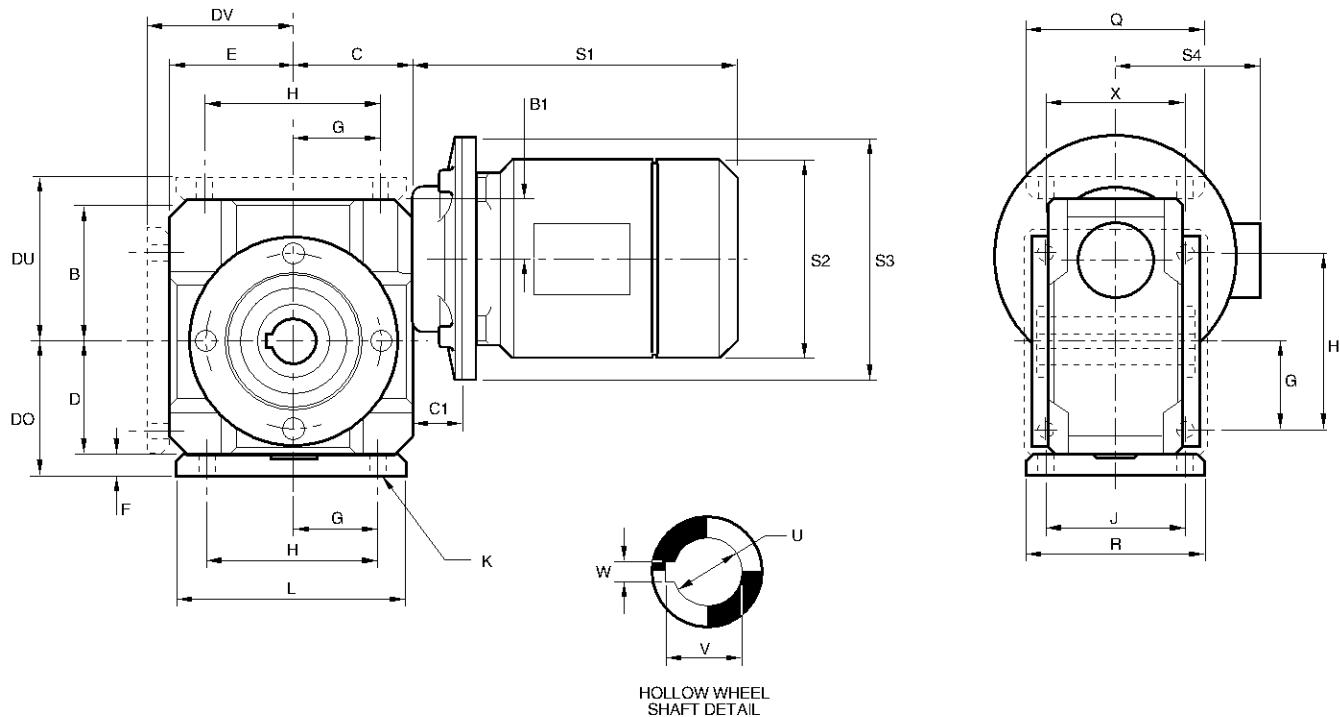

## FOOT MOUNTING-TYPE 2


Unit Ref.	DIM	D71M	D80M	D90S	D90L	D100L	D112M
	C1	34	44	44	44	54	54
JPM17	S1*	231	269	277	302	344	377
JPM22	S2*	140	157	180	180	200	211
JPM26	S3* D Flange	160	200	200	200	250	250
JPM30	S3* C Face	105	120	140	140	160	160
	S4*	106	113	120	120	136	146

Unit Ref.	K	L	R	U	V	W	X
JPM11	7	84	89	16.016 16.034	18.4 18.3	5.015 4.985	72
JPM17	12	128	125	24.020 24.041	27.5 27.3	8.018 7.982	92
JPM22	12	160	135	30.020 30.041	33.5 33.3	8.018 7.982	118
JPM26	14.5	184	150	38.025 38.050	41.5 41.3	10.018 9.982	132
JPM30	14.5	195	165	45.025 45.050	49.0 48.8	14.021 13.979	148

\*jPM11 MOTOR DIMENSIONS SEE PAGE 27

Unit Ref.	B	B1	C	D	E	Q	DO	DU	DV	F	G	H	J
JPM11	55	26.43	52	42	42	78	50	63	50	8	35	70	75
JPM17	85	40.55	78	60	67	98	73	98	80	13	47.5	95	95
JPM22	105	47.85	90	80	90	126	95	120	105	15	57.5	115	100
JPM26	117	50.33	97	92	102	140	110	135	120	18	72.5	145	115
JPM30	135	58.8	105	100	120	156	120	155	140	20	80	160	130

# jPM Speed Reducers - Dimensions (mm)

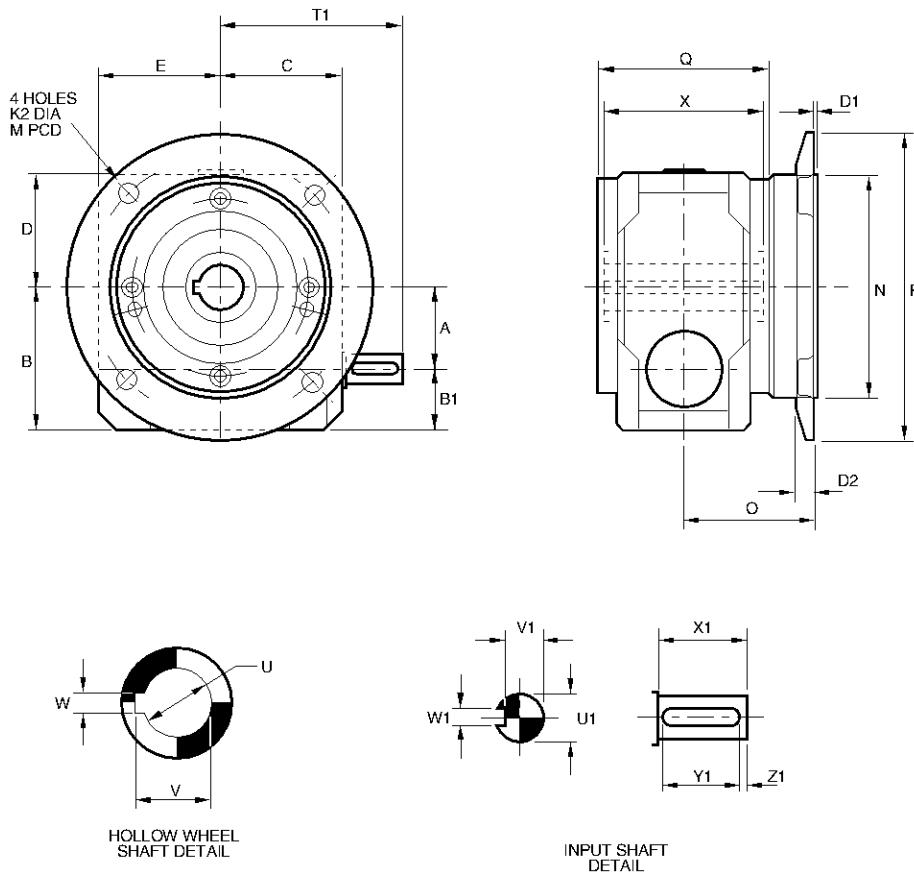


## FLANGE MOUNTING-HOLLOW OUTPUT SHAFT

Unit Ref.	A	B	B1	C	D	E	Q	D1	D2	K2	M	N	O
JPM11	28.57	55	26.43	52	42	42	78	3	7	10.0	115	95.000 94.946	60
JPM17	44.45	85	40.55	78	60	67	98	3.5	11	10.0	130	110.000 109.946	85
JPM22	57.15	105	47.85	90	80	90	126	3.5	12	12.0	165	130.000 129.937	105
JPM26	66.67	117	50.33	97	92	102	140	4	12	14.5	215	180.000 179.937	105
JPM30	76.2	135	58.8	105	100	120	156	4	12	14.5	215	180.000 179.937	130

Unit Ref.	P	T1	U1	V1	W1	X1	Y1	Z1	U	V	W	X
JPM11	140	84	12.008 11.997	9.5 9.4	3.988 3.958	30	25	2.5	16.016 16.034	18.4 18.3	5.015 4.985	72
JPM17	160	120	16.009 15.996	13.0 12.9	4.988 4.958	40	36	2	24.020 24.041	27.5 27.3	8.018 7.982	92
JPM22	200	132	19.009 18.996	15.5 15.4	5.988 5.958	40	36	2	30.020 30.041	33.5 33.3	8.018 7.982	118
JPM26	250	149	24.009 23.996	20.0 19.8	7.985 7.949	50	40	5	38.025 38.050	41.5 41.3	10.018 9.982	132
JPM30	250	157	24.009 23.996	20.0 19.8	7.985 7.949	50	40	5	45.025 45.050	49.0 48.8	14.021 13.979	148

# jPM Geared Motors - Dimensions (mm)

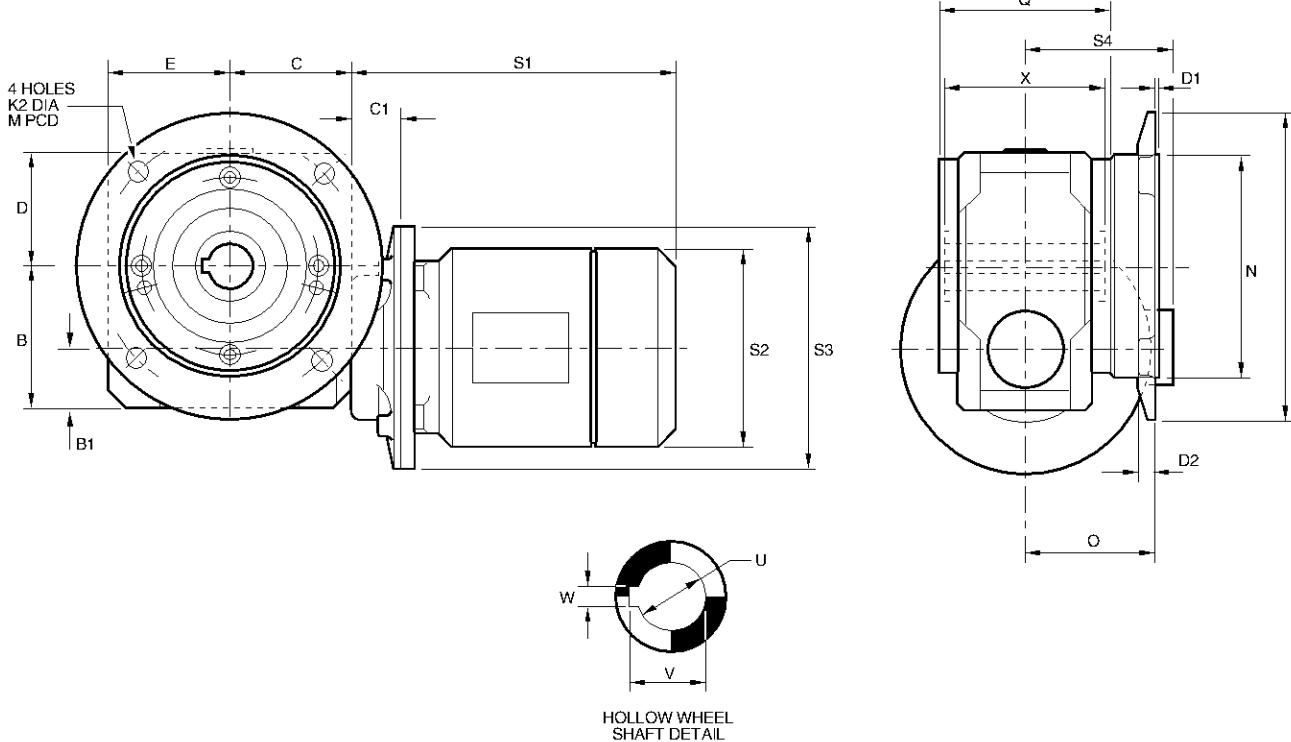

## FLANGE MOUNTING-HOLLOW OUTPUT SHAFT


Unit Ref.	DIM	D71M	D80M	D90S	D90L	D100L	D112M
JPM17	C1	34	44	44	44	54	54
JPM22	S1*	231	269	277	302	344	377
JPM26	S2*	140	157	180	180	200	211
JPM30	S3* D Flange	160	200	200	200	250	250
	S3* C Face	105	120	140	140	160	160
	S4*	106	113	120	120	136	146

Unit Ref.	U	V	W	X
JPM11	16.016 16.034	18.4 18.3	5.015 4.985	72
JPM17	24.020 24.041	27.5 27.3	8.018 7.982	92
JPM22	30.020 30.041	33.5 33.3	8.018 7.982	118
JPM26	38.025 38.050	41.5 41.3	10.018 9.982	132
JPM30	45.025 45.050	49.0 48.0	14.021 13.979	148

\*jPM11 MOTOR DIMENSIONS SEE PAGE 27

Unit Ref.	B	B1	C	D	E	Q	D1	D2	K2	M	N	O	P
JPM11	55	26.43	52	42	42	78	3	7	10.0	115	95.000 94.946	60	140
JPM17	85	40.55	78	60	67	98	3.5	11	10.0	130	110.000 109.946	85	160
JPM22	105	47.85	90	80	90	126	3.5	12	12.0	165	130.000 129.937	105	200
JPM26	117	50.33	97	92	102	140	4	12	14.5	215	180.000 179.937	105	250
JPM30	135	58.80	105	100	120	156	4	12	14.5	215	180.000 179.937	130	250

## jPM Speed Reducers - Dimensions (mm)

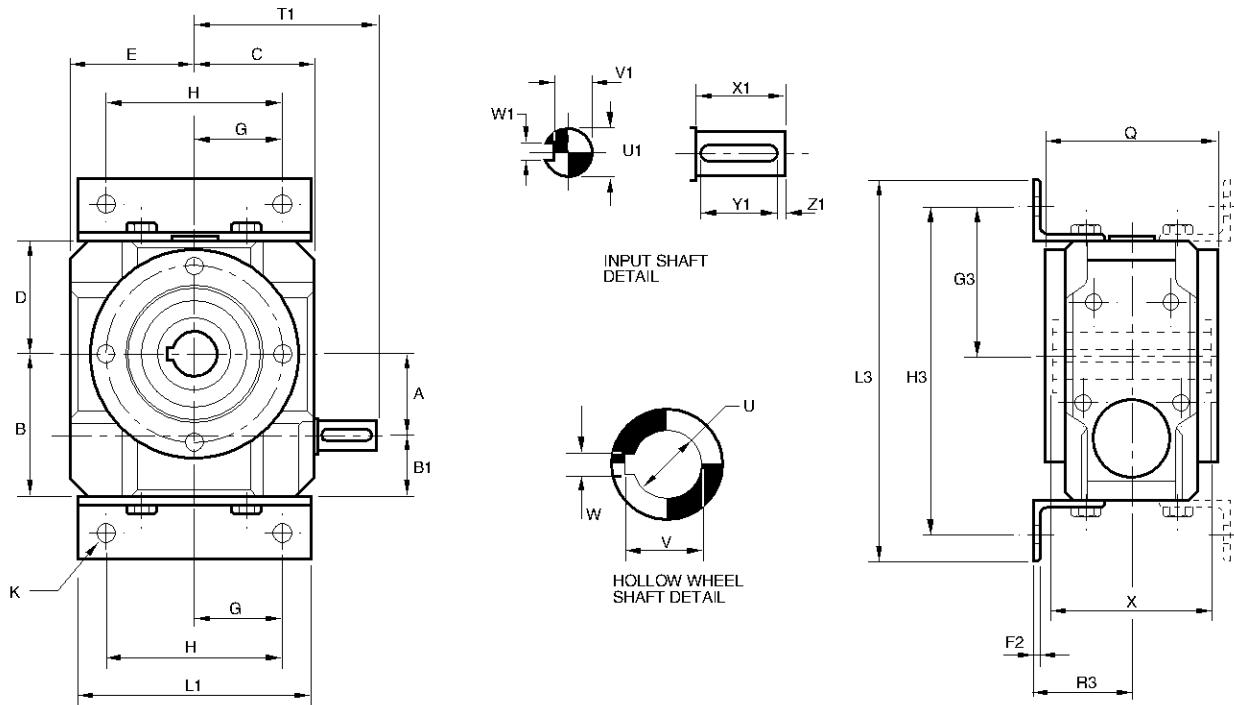


### FOOT MOUNTING-TYPE 4

Unit Ref.	A	B	B1	C	D	E	Q	F2	G	H	L1	K	G3
JPM11	28.57	55	26.43	52	42	42	78	3	35	70	84	7	60
JPM17	44.45	85	40.55	78	60	67	98	5	47.5	95	130	12	84
JPM22	57.15	105	47.85	90	80	90	126	6	57.5	115	160	12	110
JPM26	66.67	117	50.33	97	92	102	140	6	72.5	145	190	14.5	122
JPM30	76.2	135	58.8	105	100	120	156	6	80	160	200	14.5	135

Unit Ref.	H3	L3	R3	T1	U1	V1	W1	X1	Y1	Z1
JPM11	133	157	41	84	12.008 11.997	9.5 9.4	3.988 3.958	30	25	2.5
JPM17	193	225	51	120	16.009 15.996	13.0 12.9	4.988 4.958	40	36	2
JPM22	245	285	65	132	19.009 18.996	15.5 15.4	5.988 5.958	40	36	2
JPM26	269	309	72	149	24.009 23.996	20.0 19.8	7.985 7.949	50	40	5
JPM30	305	355	80	157	24.009 23.996	20.0 19.8	7.985 7.949	50	40	5

Unit Ref.	U	V	W	X
JPM11	16.016 16.034	18.4 18.3	5.015 4.985	72
JPM17	24.020 24.041	27.5 27.3	8.018 7.982	92
JPM22	30.020 30.041	33.5 33.3	8.018 7.982	118
JPM26	38.025 38.050	41.5 41.3	10.018 9.982	132
JPM30	45.025 45.050	49.0 48.8	14.021 13.979	148

## jPM Geared Motors - Dimensions (mm)

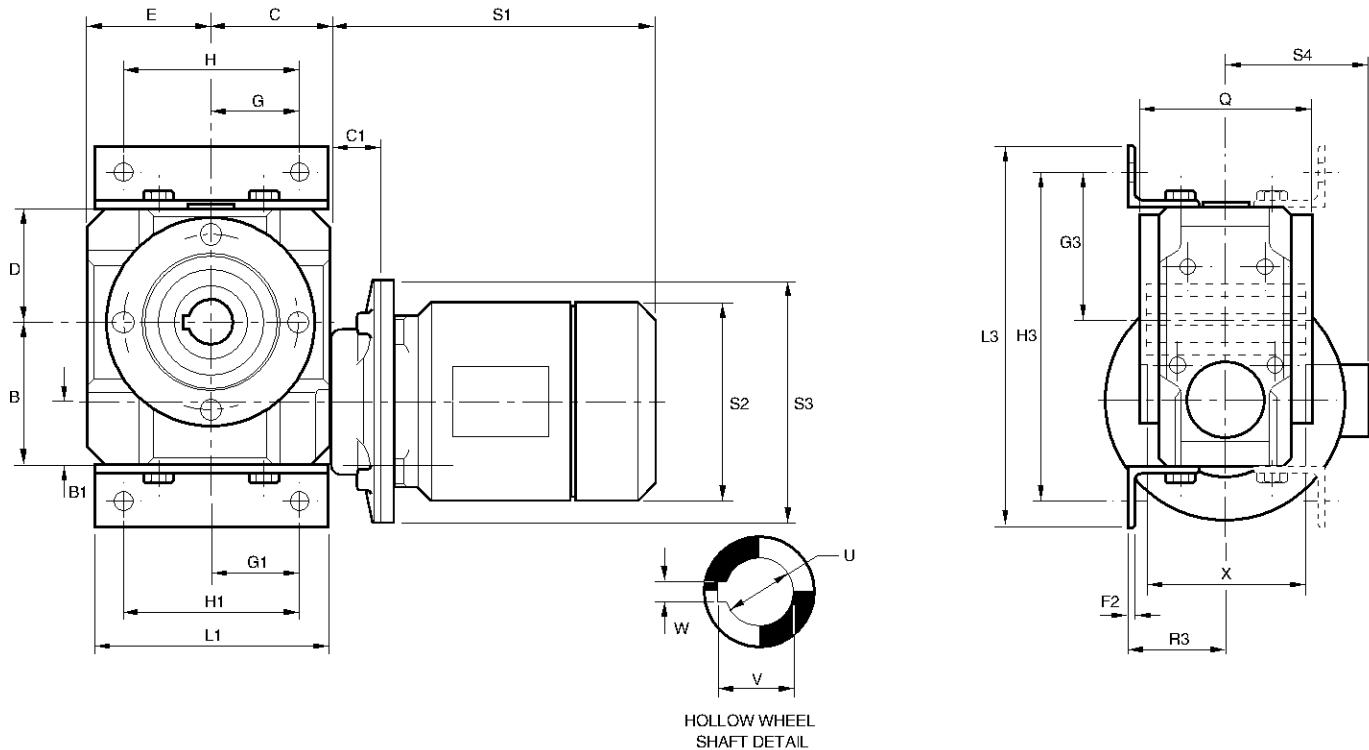

## FOOT MOUNTING-TYPE 4

Unit Ref.	DIM	D71M	D80M	D90S	D90L	D100L	D112M
	C1	34	44	44	44	54	54
JPM17	S1*	231	269	277	302	344	377
JPM22	S2*	140	157	180	180	200	211
JPM26	S3* D Flange	160	200	200	200	250	250
JPM30	S3* C Face	105	120	140	140	160	160
	S4*	106	113	120	120	136	146


Unit Ref.	H3	L3	R3	U	V	W	X
JPM11	133	157	41	16.016 16.034	18.4 18.3	5.015 4.985	72
JPM17	193	225	51	24.020 24.041	27.5 27.3	8.018 7.982	92
JPM22	245	285	65	30.020 30.041	33.5 33.3	8.018 7.982	118
JPM26	269	309	72	38.025 38.050	41.5 41.3	10.018 9.982	132
JPM30	305	355	80	45.025 45.050	49.0 48.8	14.021 13.979	148

\*jPM11 MOTOR DIMENSIONS SEE PAGE 27

Unit Ref.	B	B1	C	D	E	Q	F2	G	H	L1	K	G3
JPM11	55	26.43	52	42	42	78	3	35	70	84	7	60
JPM17	85	40.55	78	60	67	98	5	47.5	95	130	12	84
JPM22	105	47.85	90	80	90	126	6	57.5	115	160	12	110
JPM26	117	50.33	97	92	102	140	6	72.5	145	190	14.5	122
JPM30	135	58.8	105	100	120	156	6	80	160	200	14.5	135

## jPM Speed Reducers - Dimensions (mm)

PLUG-IN AND SOLID OUTPUT SHAFTS AVAILABLE

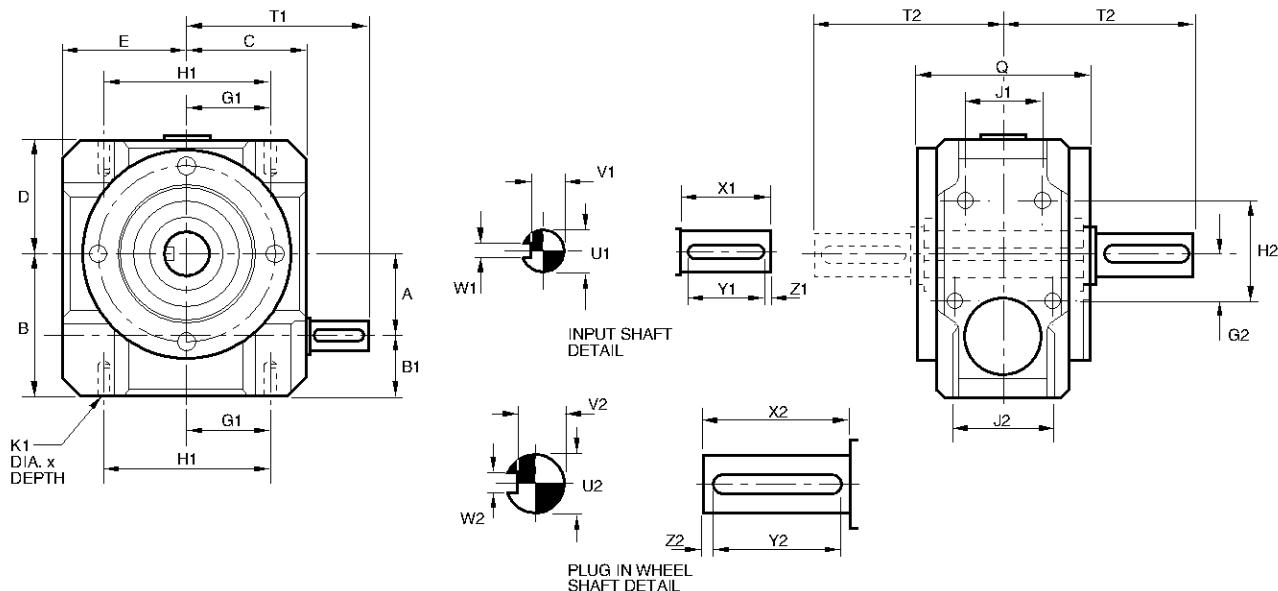


Unit Ref.	G2	H2	J2	Q	T2
JPM11	22.5	45	37	78	80
JPM17	24	69.5	57	98	100
JPM22	33	90.5	55	126	125
JPM26	43.5	87	72	140	155
JPM30	51	102	85	156	195

Unit Ref.	A	B	B1	C	D	E	G1	H1	J1	J3	K1	T1
JPM11	28.57	55	26.43	52	42	42	22.5	45	37	37	M6x11	84
JPM17	44.45	85	40.55	78	60	67	45.5	69.5	43	57	M10x17	120
JPM22	57.15	105	47.85	90	80	90	57.5	115	45	45	M10x17	132
JPM26	66.67	117	50.33	97	92	102	43.5	87	72	72	M12x20	149
JPM30	76.2	135	58.8	105	100	120	51	102	85	85	M12x22	157

Unit Ref.	U1	V1	W1	X1	Y1	Z1	U2	V2	W2	X2	Y2	Z2
JPM11	12.008 11.997	9.5 9.4	3.988 3.958	30	25	2.5	16.008 15.997	13.0 12.9	4.988 4.958	40	36	2
JPM17	16.008 15.997	13.0 12.9	4.988 4.958	40	36	2	22.009 21.996	18.5 18.4	5.988 5.958	50	45	3
JPM22	19.009 18.996	15.5 15.4	5.988 5.958	40	36	2	28.009 27.996	24.0 23.8	7.985 7.949	60	50	5
JPM26	24.009 23.996	20.0 19.8	7.985 7.949	50	40	5	32.018 32.002	27.0 26.8	9.985 9.949	80	70	5
JPM30	24.009 23.996	20.0 19.8	7.985 7.949	50	40	5	40.018 40.002	35.0 34.8	11.982 11.939	110	100	5

# jPM Geared Motors - Dimensions (mm)

PLUG-IN AND SOLID OUTPUT SHAFTS AVAILABLE

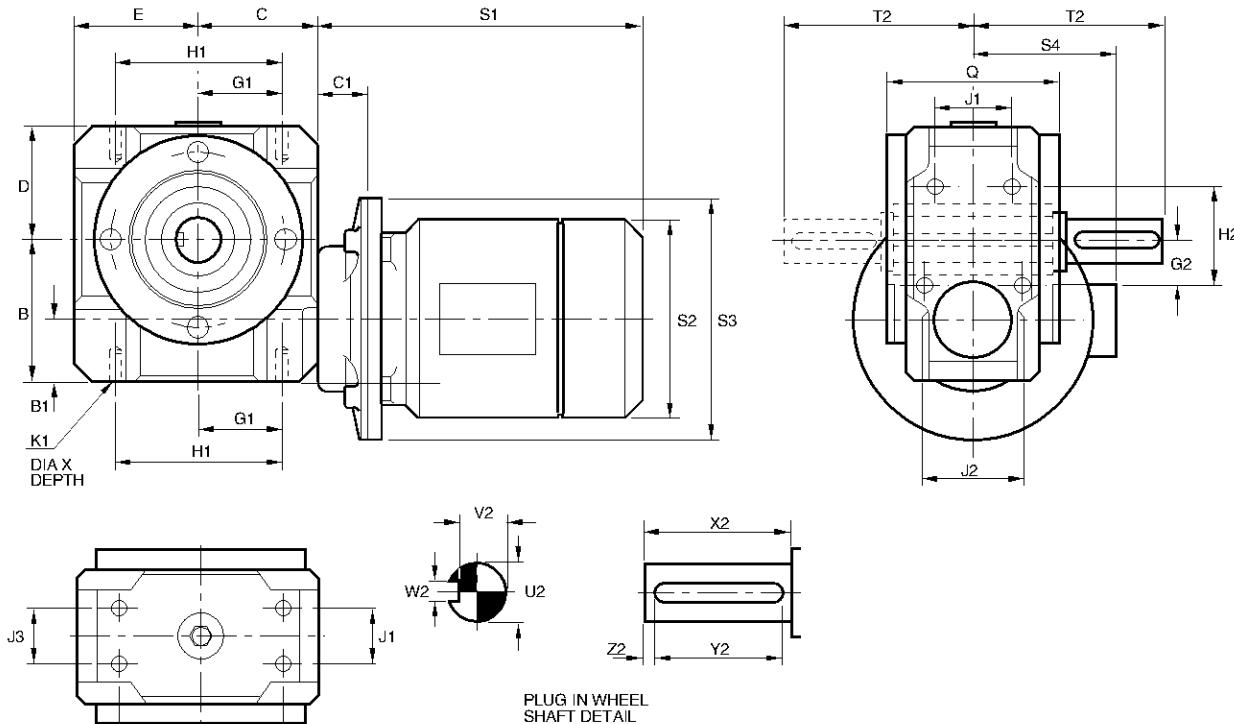

Unit Ref.	DIM	D71M	D80M	D90S	D90L	D100L	D112M
JPM17	C1	34	44	44	44	54	54
	S1*	231	269	277	302	344	377
	S2*	140	157	180	180	200	211
	S3* D Flange	160	200	200	200	250	250
	S3* C Face	105	120	140	140	160	160
	S4*	106	113	120	120	136	146


\*jPM11 MOTOR DIMENSIONS SEE PAGE 27

Unit Ref.	B	B1	C	D	E	G1	H1	J3
JPM11	55	26.43	52	42	42	22.5	45	37
JPM17	85	40.55	78	60	67	45.5	69.5	57
JPM22	105	47.85	90	80	90	57.5	115	45
JPM26	117	50.33	97	92	102	43.5	87	72
JPM30	135	58.8	105	100	120	51	102	85

Unit Ref.	K1	U2	V2	W2	X2	Y2	Z2	G2	H2	J1	J2	Q	T2
JPM11	M6x11 16.008 15.997	13.0 12.9	4.988 4.958	40	36	2	22.5	45	37	37	78	80	
JPM17	M10x17 22.009 21.996	16.5 16.4	5.988 5.958	50	45	3	24	69.5	43	57	98	100	
JPM22	M10x17 28.009 27.996	24.0 23.8	7.985 7.949	60	50	5	33	90.5	45	55	126	125	
JPM26	M12x20 32.018 32.002	27.0 26.8	9.985 9.949	80	70	5	43.5	87	72	72	140	155	
JPM30	M12x22 40.018 40.002	35.0 34.8	11.982 11.939	110	100	5	51	102	85	85	156	195	

## jPM Speed Reducers - Dimensions (mm)

PLUG-IN AND SOLID OUTPUT SHAFTS AVAILABLE

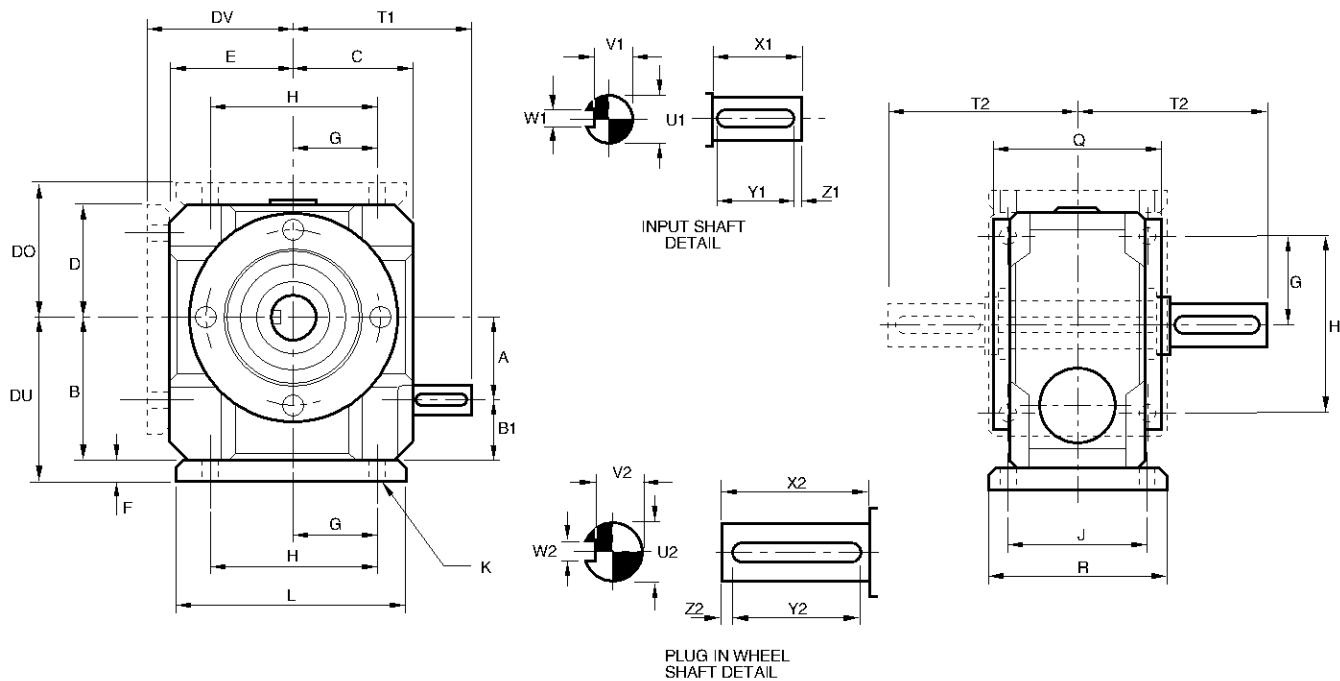

### FOOT MOUNTING-TYPE 2


Unit Ref.	A	B	B1	C	D	E	Q	DO	DU	DV	F	G	H
JPM11	28.57	55	26.43	52	42	42	78	50	63	50	8	35	70
JPM17	44.45	85	40.55	78	60	67	98	73	98	80	13	47.5	95
JPM22	57.15	105	47.85	90	80	90	126	95	120	105	15	57.5	115
JPM26	66.67	117	50.33	97	92	102	140	110	135	120	18	72.5	145
JPM30	76.2	135	58.8	105	100	120	156	120	155	140	20	80	160

Unit Ref.	J	K	L	R	T1	U1	V1	W1	X1	Y1	Z1
JPM11	75	7	84	89	84	12.008 11.997	9.5 9.4	3.988 3.958	30	25	2.5
JPM17	95	12	128	125	120	16.009 15.996	13.0 12.9	4.988 4.958	40	36	2
JPM22	100	12	160	135	132	19.009 18.996	15.5 15.4	5.988 5.958	40	36	2
JPM26	115	14.5	184	150	149	24.009 23.996	20.0 19.8	7.985 7.949	50	40	5
JPM30	130	14.5	195	165	157	24.009 23.996	20.0 19.8	7.985 7.949	50	40	5

Unit Ref.	T2	U2	V2	W2	X2	Y2	Z2
JPM11	80	16.008 15.997	13.0 12.9	4.988 4.958	40	36	2
JPM17	100	22.009 21.996	18.5 18.4	5.988 5.958	50	45	3
JPM22	125	28.009 27.996	24.0 23.8	7.985 7.949	60	50	5
JPM26	155	32.018 32.002	27.0 26.8	9.985 9.949	80	70	5
JPM30	195	40.018 40.002	35.0 34.8	11.982 11.939	110	100	5

# jPM Geared Motors - Dimensions (mm)

PLUG-IN AND SOLID OUTPUT SHAFTS AVAILABLE

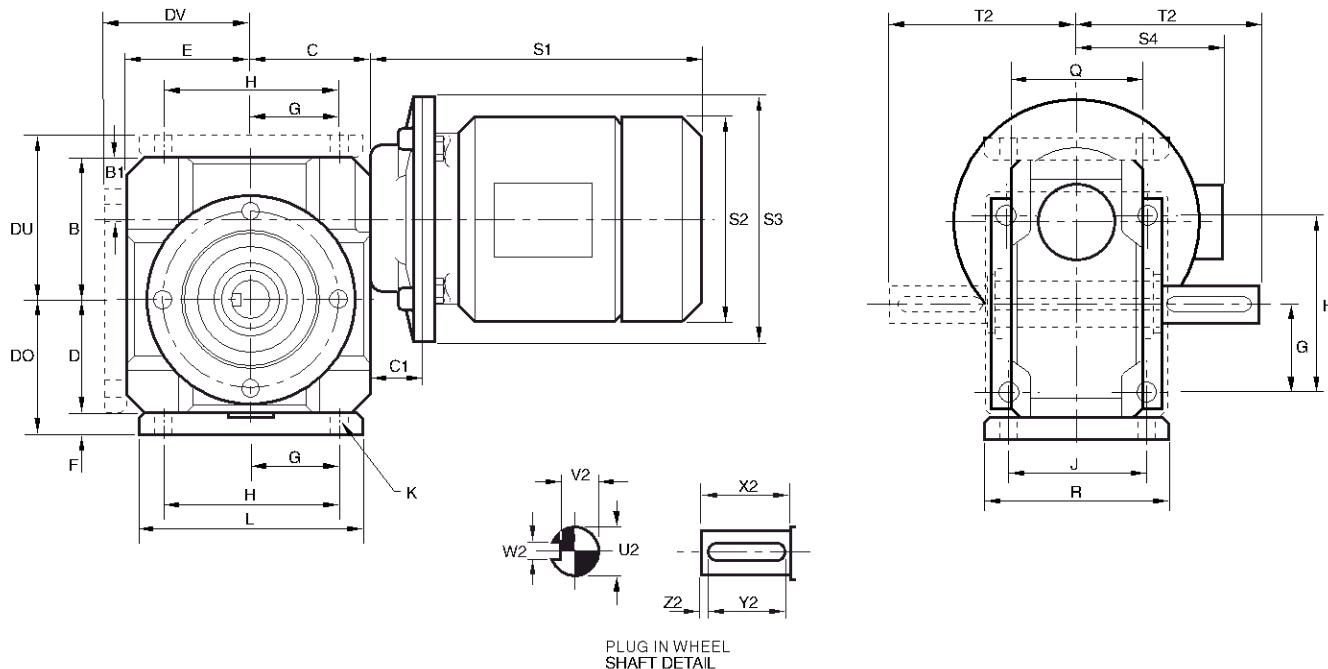

## FOOT MOUNTING-TYPE 2

Unit Ref.	DIM	D71M	D80M	D90S	D90L	D100L	D112M
JPM17	C1	34	44	44	44	54	54
JPM17	S1*	231	269	277	302	344	377
JPM22	S2*	140	157	180	180	200	211
JPM26	S3* D Flange	160	200	200	200	250	250
JPM30	S3* C Face	105	120	140	140	160	160
	S4*	106	113	120	120	136	146


\*jPM11 MOTOR DIMENSIONS SEE PAGE 27

Unit Ref.	K	L	R	T2	U2	V2	W2	X2	Y2	Z2
JPM11	7	84	89	80	16.008 15.997	13.0 12.9	4.968 4.958	40	36	2
JPM17	12	128	125	100	22.009 21.996	18.5 18.4	5.988 5.958	50	45	3
JPM22	12	160	135	125	28.009 27.996	24.0 23.8	7.985 7.949	60	50	5
JPM26	14.5	184	150	155	32.018 32.002	27.0 26.8	9.985 9.949	80	70	5
JPM30	14.5	195	165	195	49.018 49.002	35.0 34.8	11.982 11.949	110	100	5

Unit Ref.	B	B1	C	D	E	Q	DO	DU	DV	F	G	H	J
JPM11	55	26.43	52	42	42	78	50	63	50	8	35	70	75
JPM17	85	40.55	78	60	67	98	73	98	80	13	47.5	95	95
JPM22	105	47.85	90	80	90	126	95	120	105	15	57.5	115	100
JPM26	117	50.33	97	92	102	140	110	135	120	18	72.5	145	115
JPM30	135	58.8	105	100	120	156	120	155	140	20	80	160	130

# jPM Speed Reducers - Dimensions (mm)

PLUG-IN OUTPUT SHAFTS AVAILABLE WITH T3 DIMENSION  
 PLUG-IN AND SOLID OUTPUT SHAFTS AVAILABLE WITH T2 DIMENSION.

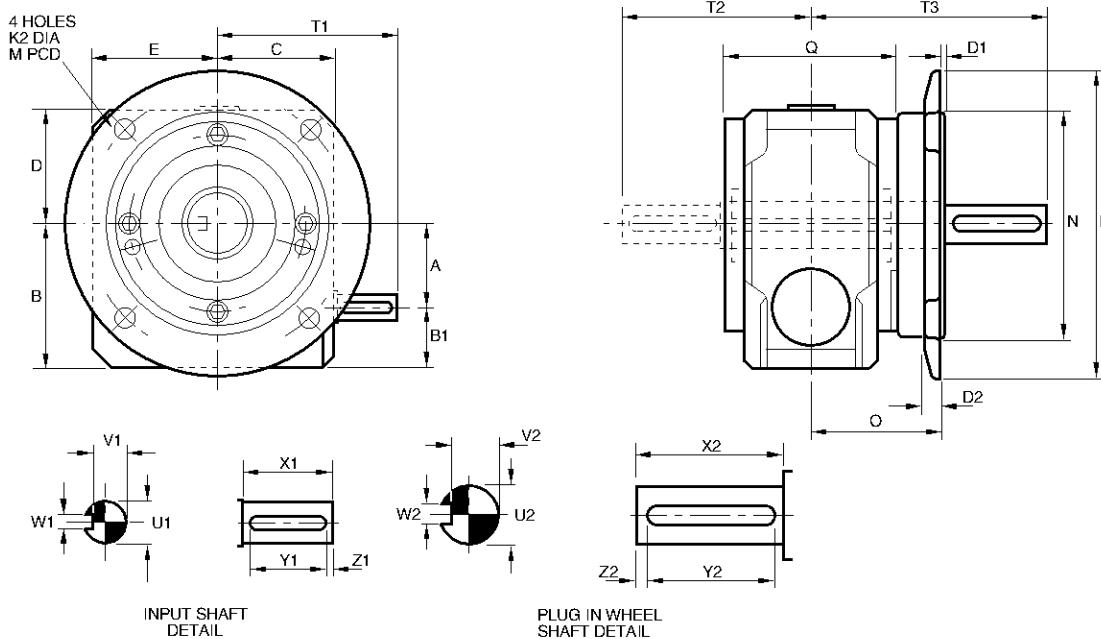

## FLANGE MOUNTING


Unit Ref.	A	B	B1	C	D	E	Q	D1	D2	K2	M	N	O
JPM11	28.57	55	26.43	52	42	42	78	3	7	10.0	115	95.000 94.946	60
JPM17	44.45	85	40.55	78	60	67	98	3.5	11	10.0	130	110.000 109.946	85
JPM22	57.15	105	47.85	90	80	90	126	3.5	12	12.0	165	130.000 129.957	105
JPM26	66.67	117	50.33	97	92	102	140	4	12	14.5	215	180.000 179.957	105
JPM30	76.2	135	58.8	105	100	120	156	4	12	14.5	215	180.000 179.957	130

Unit Ref.	P	T1	U1	V1	W1	X1	Y1	Z1
JPM11	140	84	12.008 11.997	9.5 9.4	3.988 3.958	30	25	2.5
JPM17	160	120	16.009 15.996	13.0 12.9	4.988 4.958	40	36	2
JPM22	200	132	19.009 18.996	15.5 15.4	5.988 5.958	40	36	2
JPM26	250	149	24.009 23.996	20.0 19.8	7.985 7.949	50	40	5
JPM30	250	157	24.009 23.996	20.0 19.8	7.985 7.949	50	40	5

Unit Ref.	T2	T3	U2	V2	W2	X2	Y2	Z2
JPM11	80	100	16.008 15.997	13.0 12.9	4.988 4.958	40	36	2
JPM17	100	135	22.009 21.996	18.5 18.4	5.988 5.958	50	45	3
JPM22	125	165	28.009 27.996	24.0 23.8	7.985 7.949	60	50	5
JPM26	155	185	32.016 32.002	27.0 26.8	9.985 9.949	80	70	5
JPM30	195	240	40.018 40.002	35.0 34.8	11.982 11.939	110	100	5

## jPM Geared Motors - Dimensions (mm)

PLUG-IN OUTPUT SHAFTS AVAILABLE WITH T3 DIMENSION  
 PLUG-IN AND SOLID OUTPUT SHAFTS AVAILABLE WITH T2 DIMENSION.

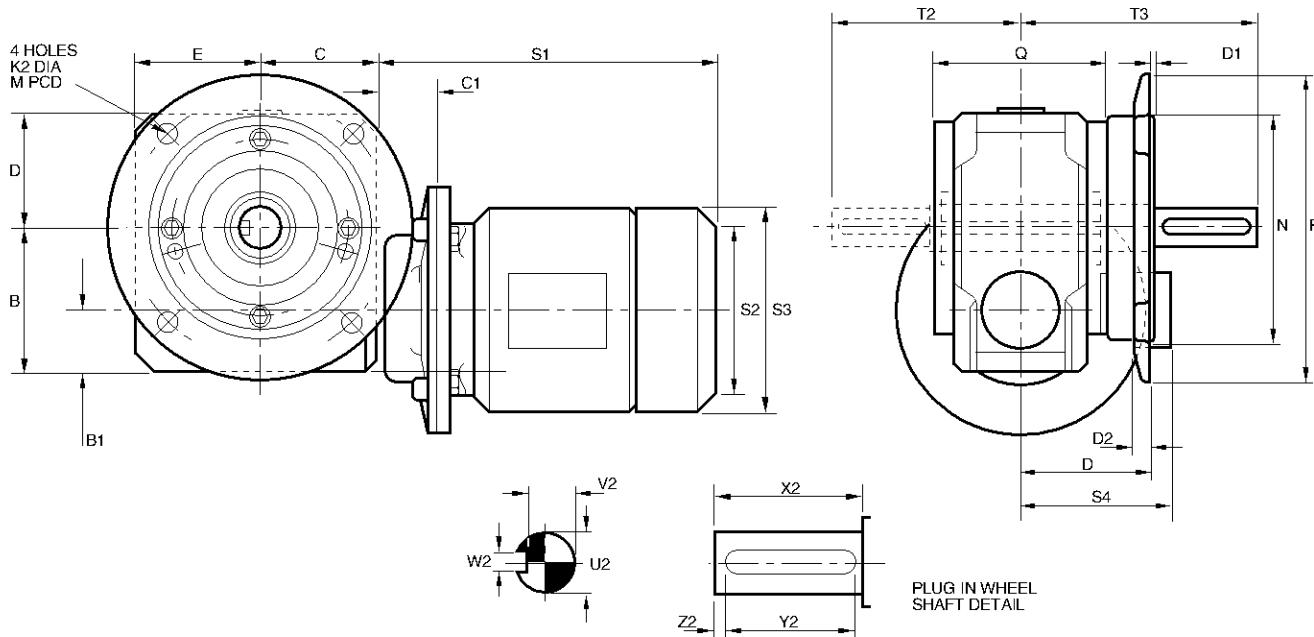

## FLANGE MOUNTING

Unit Ref.	DIM	D71M	D80M	D90S	D90L	D100L	D112M
	C1	34	44	44	44	54	54
JPM17	S1*	231	269	277	302	344	377
JPM22	S2*	140	157	180	180	200	211
JPM26	S3* D Flange	160	200	200	200	250	250
JPM30	S3* C Face	105	120	140	140	160	160
	S4*	106	113	120	120	136	146


Unit Ref.	T2	T3	U2	V2	W2	X2	Y2	Z2
JPM11	80	100	16.008 15.997	13.0 12.9	4.988 4.958	40	36	2
JPM17	100	135	22.009 21.996	18.5 18.4	5.988 5.958	50	45	3
JPM22	125	165	28.009 27.996	24.0 23.8	7.985 7.949	60	50	5
JPM26	155	185	32.018 32.002	27.0 26.8	9.985 9.949	80	70	5
JPM30	195	240	40.018 40.002	35.0 34.8	11.982 11.939	110	100	5

\*jPM11 MOTOR DIMENSIONS SEE PAGE 27

Unit Ref.	B	B1	C	D	E	Q	D1	D2	K2	M	N	O	P
JPM11	55	26.43	52	42	42	78	3	7	10.0	115	95.000 94.946	60	140
JPM17	85	40.55	78	60	67	98	3.5	11	10.0	130	110.000 109.946	85	160
JPM22	105	47.85	90	80	90	126	3.5	12	12.0	165	130.000 129.937	105	200
JPM26	117	50.33	97	92	102	104	4	12	14.5	215	180.000 179.937	105	250
JPM30	135	58.8	105	100	120	156	4	12	14.5	215	180.000 179.937	130	250

## jPM Speed Reducers - Dimensions (mm)

PLUG-IN AND SOLID OUTPUT SHAFTS AVAILABLE

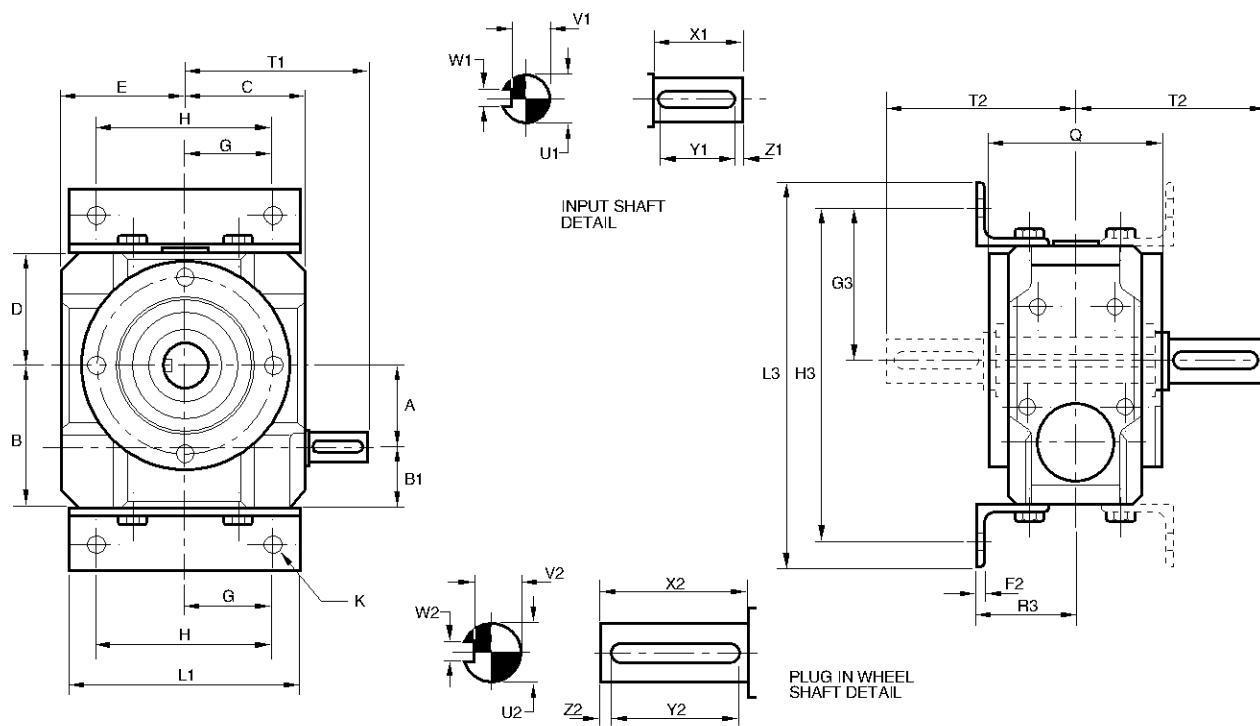

### FOOT MOUNTING-TYPE 4


Unit Ref.	A	B	B1	C	D	E	Q	F2	G	H	L1	K	G3
JPM11	28.57	55	26.43	52	42	42	78	3	35	70	84	7	60
JPM17	44.45	85	40.55	78	60	67	98	5	47.5	95	130	12	84
JPM22	57.15	105	47.85	90	80	90	126	6	57.5	115	160	12	110
JPM26	66.67	117	50.33	97	92	102	140	6	72.5	145	190	14.5	122
JPM30	76.2	135	58.8	105	100	120	156	6	80	160	200	14.5	135

Unit Ref.	H3	L3	R3	T1	U1	V1	W1	X1	Y1	Z1
JPM11	133	157	41	84	12.008 11.997	9.5 9.4	3.988 3.958	30	25	2.5
JPM17	193	225	51	120	16.009 15.996	13.0 12.9	4.988 4.958	40	36	2
JPM22	245	285	65	132	19.009 18.996	15.5 15.4	5.988 5.958	40	36	2
JPM26	269	309	72	149	24.009 23.996	20.0 19.8	7.985 7.949	50	40	5
JPM30	305	355	80	157	24.009 23.996	20.0 19.8	7.985 7.949	50	40	5

Unit Ref.	T2	U2	V2	W2	X2	Y2	Z2
JPM11	80	16.008 15.997	13.0 12.9	4.988 4.958	40	36	2
JPM17	100	22.009 21.996	18.5 18.4	5.988 5.958	50	45	3
JPM22	125	26.009 27.996	24.0 23.8	7.985 7.949	60	50	5
JPM26	155	32.018 32.002	27.0 26.8	9.985 9.949	80	70	5
JPM30	195	40.018 40.002	35.0 34.8	11.982 11.949	110	100	5

## jPM Geared Motors - Dimensions (mm)

PLUG-IN AND SOLID OUTPUT SHAFTS AVAILABLE

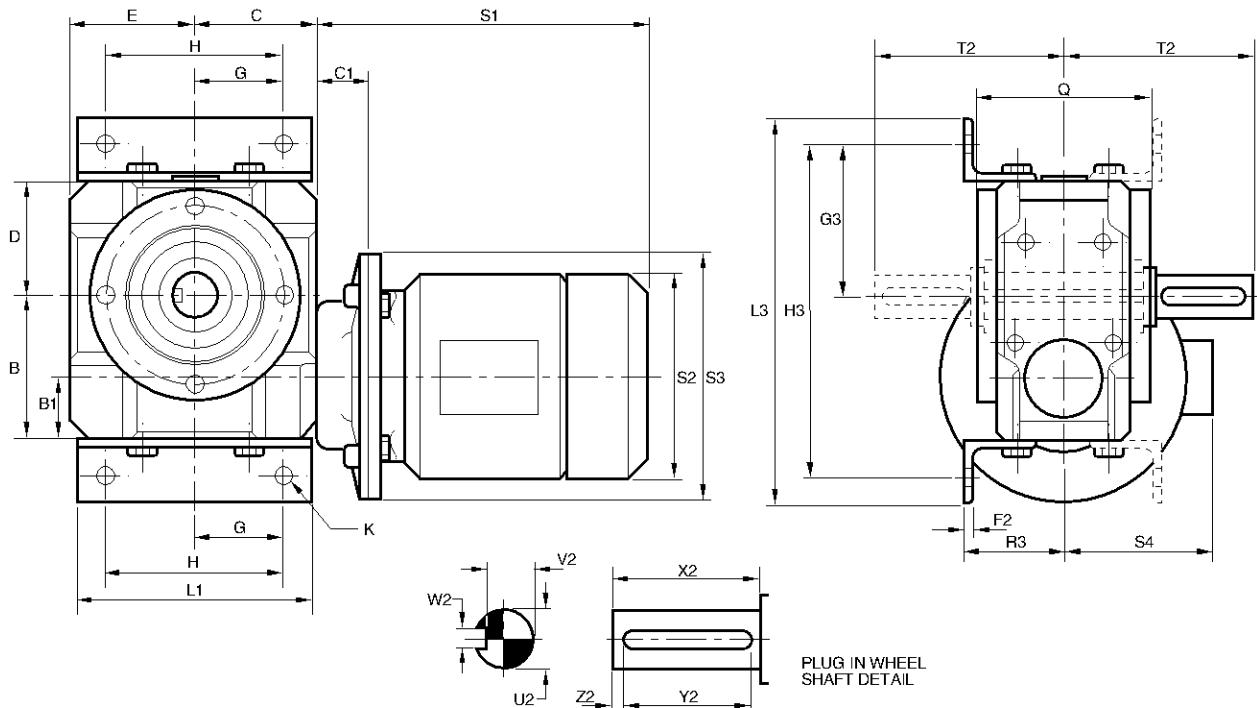

FOOT MOUNTING-TYPE 4

Unit Ref.	DIM	D71M	D80M	D90S	D90L	D100L	D112M
JPM17	C1	34	44	44	44	54	54
JPM17	S1*	231	269	277	302	344	377
JPM22	S2*	140	157	180	180	200	211
JPM26	S3* D Flange	160	200	200	200	250	250
JPM30	S3* C Face	105	120	140	140	160	160
	S4*	106	113	120	120	136	146


\*JPM11 MOTOR DIMENSIONS SEE PAGE 27

Unit Ref.	B	B1	C	D	E	Q	F2	G	H	L1	K	G3
JPM11	55	26.43	52	42	42	78	3	35	70	84	7	60
JPM17	85	40.55	78	60	67	98	5	47.5	95	130	12	84
JPM22	105	47.85	90	80	90	126	6	57.5	115	160	12	110
JPM26	117	50.33	97	92	102	140	6	72.5	145	190	14.5	122
JPM30	135	58.8	105	100	120	156	6	80	160	200	14.5	135

Unit Ref.	H3	L3	R3	T2	U2	V2	W2	X2	Y2	Z2
JPM11	133	157	41	80	16.008 15.997	13.0 12.9	4.988 4.958	40	36	2
JPM17	193	225	51	100	22.009 21.996	18.5 18.4	5.988 5.958	50	45	3
JPM22	245	285	65	125	28.009 27.996	24.0 23.8	7.985 7.949	60	50	5
JPM26	269	309	72	155	32.018 32.002	27.0 26.8	9.985 9.949	80	70	5
JPM30	305	355	80	195	40.018 40.002	35.0 34.8	11.982 11.939	110	100	5


## jPM Torque Restraints - Dimensions (mm)

### TORQUE RESTRAINT BRACKET

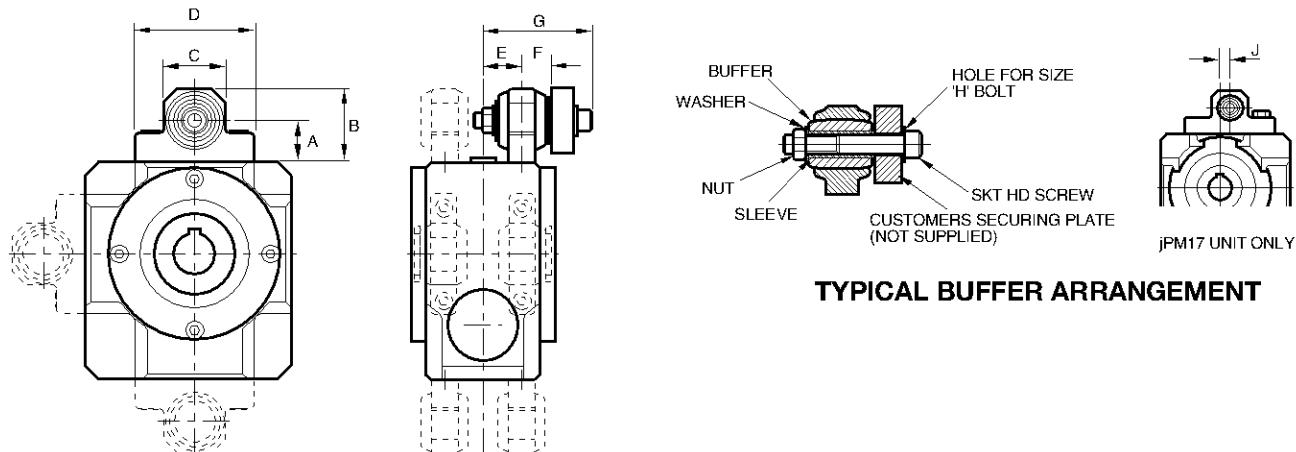

Unit Ref.	A	B	C	D	E	F	G	H	I	J	BUFFER TIGHTENING TORQUE	
											Nm	lb.ft
JPM11	21	39	31	61	18.5	14	54	M8	12	-	23	17
JPM17	30	50	40	100	28.5	17	72.5	M10	15	10.75	46	34
JPM22	35	60	50	145	22.5	23.5	78.5	M12	18	-	80	59
JPM26	43	74	62	117	36	31.5	110.5	M16	24	-	197	145
JPM30	45	79	68	132	43.5	30.5	117	M16	24	-	197	145

### TORQUE ARM

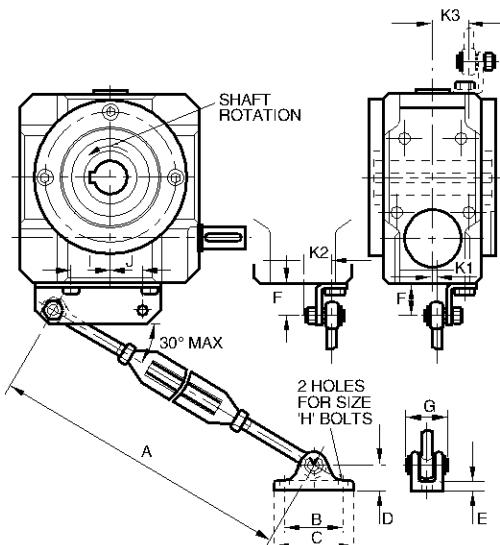

Unit Ref.	A	B	C	D	E	F	G	H	I	J	K1	K2	K3
JPM11	500 350	50	70	24	8	22	40	M8	20	20	-13	8	29
JPM17	500 350	50	70	24	8	28	40	M8	30	30	-10	13	37
JPM22	650 500	65	89	28	10	30	47	M10	49.5	50.5	-8	18	27
JPM26	650 500	65	89	28	10	30	47	M10	63.5	36.5	5.5	31.5	40.5
JPM30	650 500	65	89	28	10	30	47	M10	56	44	12	38	47

The angle between the torque arm and the input shaft must not exceed 30° and the arm must be positioned so that it is in tension when loaded: see diagram where the torque reaction is

opposite to the direction of rotation of the output. It is preferred that the torque arm is situated to that side of the gear unit which is adjacent to the driven machine.

Where the duty involves reversing, two torque arms must be fitted, arranged for both directions of rotation. Two holes are available in the bracket to facilitate this.

## jPM Unit Ratings - Single Reduction

NOMINAL RATIO 5 TO 1



**IMPORTANT**  
Units to ATEX approval must be selected with a minimum service factor of 1.25

DESCRIPTION	UNIT SIZE				
	11	17	22	26	30
<b>ACTUAL RATIO</b>	31:6	31:6	29:6	31:6	31:6
<b>1500 RPM INPUT</b>					
Output speed RPM	290.3	290.3	310.3	290.3	290.3
Input power kW	0.50	1.50	3.87	5.01	6.66
Output power kW	0.46	1.40	3.63	4.72	6.29
Output torque Nm	15.1	46	112	155	207
<b>1000 RPM INPUT</b>					
Output speed RPM	193.5	193.5	206.9	193.5	193.5
Input power kW	0.33	1.02	2.96	3.63	5.06
Output power kW	0.30	0.95	2.75	3.39	4.74
Output torque Nm	15.0	47	127	167	234
<b>750 RPM INPUT</b>					
Output speed RPM	145.2	145.2	155.2	145.2	145.2
Input power kW	0.25	0.79	2.28	2.79	3.80
Output power kW	0.23	0.72	2.11	2.58	3.53
Output torque Nm	14.9	47	130	170	244
<b>500 RPM INPUT</b>					
Output speed RPM	96.8	96.8	103.4	96.8	96.8
Input power kW	0.17	0.52	1.57	1.90	2.54
Output power kW	0.15	0.48	1.43	1.74	2.34
Output torque Nm	14.8	47	133	172	255
<b>250 RPM INPUT</b>					
Output speed RPM	48.4	48.4	51.7	48.4	48.4
Input power kW	0.08	0.26	0.81	0.98	1.47
Output power kW	0.07	0.23	0.72	0.88	1.33
Output torque Nm	14.6	46	134	175	262

**jPM Unit Ratings - Single Reduction**

NOMINAL RATIO 7.5 TO 1



IMPORTANT

Units to ATEX approval must be selected with a minimum service factor of 1.25

DESCRIPTION	UNIT SIZE				
	11	17	22	26	30
<b>ACTUAL RATIO</b>	29:4	29:4	29:4	29:4	29:4
<b>1500 RPM INPUT</b>					
Output speed RPM	206.9	206.9	206.9	206.9	206.9
Input power kW	0.48	1.45	2.75	4.11	5.83
Output power kW	0.44	1.34	2.56	3.84	5.47
Output torque Nm	20	62	118	177	253
<b>1000 RPM INPUT</b>					
Output speed RPM	137.9	137.9	137.9	137.9	137.9
Input power kW	0.38	1.14	2.17	3.25	4.59
Output power kW	0.34	1.04	2.00	3.01	4.27
Output torque Nm	24	72	138	208	296
<b>750 RPM INPUT</b>					
Output speed RPM	103.4	103.4	103.4	103.4	103.4
Input power kW	0.31	0.95	1.80	2.70	3.85
Output power kW	0.28	0.87	1.65	2.48	3.56
Output torque Nm	26	80	153	229	328
<b>500 RPM INPUT</b>					
Output speed RPM	68.9	68.9	68.9	68.9	68.9
Input power kW	0.21	0.70	1.22	1.82	2.70
Output power kW	0.18	0.63	1.10	1.66	2.46
Output torque Nm	26	88	153	230	341
<b>250 RPM INPUT</b>					
Output speed RPM	34.5	34.5	34.5	34.5	34.5
Input power kW	0.10	0.35	0.61	0.92	1.36
Output power kW	0.09	0.31	0.54	0.82	1.21
Output torque Nm	25	86	151	227	336

## jPM Unit Ratings - Single Reduction

NOMINAL RATIO 10 TO 1



IMPORTANT

Units to ATEX approval must be selected with a minimum service factor of 1.25

DESCRIPTION	UNIT SIZE				
	11	17	22	26	30
ACTUAL RATIO	29:3	29:3	29:3	29:3	29:3
1500 RPM INPUT					
Output speed RPM	155.2	155.2	155.2	155.2	155.2
Input power kW	0.41	1.25	2.23	3.30	4.70
Output power kW	0.37	1.13	2.06	3.05	4.36
Output torque Nm	23	70	127	188	269
1000 RPM INPUT					
Output speed RPM	103.4	103.4	103.4	103.4	103.4
Input power kW	0.32	0.97	1.75	2.64	3.75
Output power kW	0.29	0.87	1.60	2.41	3.44
Output torque Nm	26	80	147	223	318
750 RPM INPUT					
Output speed RPM	77.6	77.6	77.6	77.6	77.6
Input power kW	0.27	0.81	1.47	2.21	3.14
Output power kW	0.23	0.72	1.33	2.00	2.86
Output torque Nm	29	89	164	246	352
500 RPM INPUT					
Output speed RPM	51.7	51.7	51.7	51.7	51.7
Input power kW	0.20	0.62	1.12	1.67	2.41
Output power kW	0.18	0.55	0.99	1.50	2.17
Output torque Nm	32	101	184	276	401
250 RPM INPUT					
Output speed RPM	25.9	25.9	25.9	25.9	25.9
Input power kW	0.10	0.36	0.56	0.84	1.25
Output power kW	0.09	0.31	0.49	0.74	1.10
Output torque Nm	32	113	182	273	406

**jPM Unit Ratings - Single Reduction**

NOMINAL RATIO 12.5 TO 1



IMPORTANT

Units to ATEX approval must be selected with a minimum service factor of 1.25

DESCRIPTION	UNIT SIZE				
	11	17	22	26	30
<b>ACTUAL RATIO</b>	37:3	37:3	37:3	37:3	37:3
<b>1500 RPM INPUT</b>					
Output speed RPM	121.6	121.6	121.6	121.6	121.6
Input power kW	0.35	1.07	2.14	3.03	4.28
Output power kW	0.31	0.95	1.94	2.77	3.91
Output torque Nm	24	75	152	217	308
<b>1000 RPM INPUT</b>					
Output speed RPM	81.1	81.1	81.1	81.1	81.1
Input power kW	0.27	0.85	1.67	2.39	3.56
Output power kW	0.23	0.75	1.49	2.15	3.22
Output torque Nm	28	88	176	253	379
<b>750 RPM INPUT</b>					
Output speed RPM	60.8	60.8	60.8	60.8	60.8
Input power kW	0.23	0.73	1.39	1.98	2.95
Output power kW	0.19	0.63	1.23	1.76	2.64
Output torque Nm	31	100	194	277	414
<b>500 RPM INPUT</b>					
Output speed RPM	40.5	40.5	40.5	40.5	40.5
Input power kW	1.17	0.55	1.06	1.46	2.28
Output power kW	0.14	0.47	0.92	1.28	2.01
Output torque Nm	33	112	217	303	473
<b>250 RPM INPUT</b>					
Output speed RPM	20.3	20.3	20.3	20.3	20.3
Input power kW	0.08	0.33	0.54	0.74	1.29
Output power kW	0.07	0.28	0.46	0.63	1.10
Output torque Nm	33	131	215	299	521

## jPM Unit Ratings - Single Reduction

NOMINAL RATIO 15 TO 1

**! IMPORTANT**  
Units to ATEX approval must be selected with a minimum service factor of 1.25

DESCRIPTION	UNIT SIZE				
	11	17	22	26	30
<b>ACTUAL RATIO</b>	31:2	31:2	29:2	31:2	31:2
<b>1500 RPM INPUT</b>					
Output speed RPM	96.8	96.8	103.4	96.8	96.8
Input power kW	0.30	0.88	2.01	2.82	3.58
Output power kW	0.26	0.77	1.79	2.53	3.22
Output torque Nm	26	76	166	250	318
<b>1000 RPM INPUT</b>					
Output speed RPM	64.5	64.5	68.9	64.5	64.5
Input power kW	0.24	0.70	1.57	2.20	3.07
Output power kW	0.20	0.61	1.38	1.94	2.71
Output torque Nm	29	90	190	287	401
<b>750 RPM INPUT</b>					
Output speed RPM	48.4	48.4	51.7	48.4	48.4
Input power kW	0.20	0.60	1.30	1.70	2.54
Output power kW	0.16	0.51	1.13	1.48	2.21
Output torque Nm	32	101	208	293	437
<b>500 RPM INPUT</b>					
Output speed RPM	32.2	32.2	34.5	32.2	32.2
Input power kW	0.14	0.45	0.88	1.16	1.90
Output power kW	0.11	0.37	0.75	0.99	1.63
Output torque Nm	33	111	209	295	482
<b>250 RPM INPUT</b>					
Output speed RPM	16.1	16.1	17.2	16.1	16.1
Input power kW	0.07	0.23	0.45	0.59	1.01
Output power kW	0.05	0.19	0.37	0.49	0.84
Output torque Nm	33	110	207	292	497

**jPM Unit Ratings - Single Reduction**

NOMINAL RATIO 20 TO 1



IMPORTANT

Units to ATEX approval must be selected with a minimum service factor of 1.25

DESCRIPTION	UNIT SIZE				
	11	17	22	26	30
<b>ACTUAL RATIO</b>	41:2	41:2	39:2	41:2	41:2
<b>1500 RPM INPUT</b>					
Output speed RPM	73.2	73.2	76.9	73.2	73.2
Input power kW	0.22	0.71	1.45	2.03	2.85
Output power kW	1.18	0.60	1.26	1.77	2.51
Output torque Nm	24	78	157	231	327
<b>1000 RPM INPUT</b>					
Output speed RPM	48.8	48.8	51.3	48.8	48.8
Input power kW	0.17	0.55	1.11	1.57	2.23
Output power kW	0.14	0.45	0.95	1.35	1.92
Output torque Nm	27	89	176	263	377
<b>750 RPM INPUT</b>					
Output speed RPM	36.6	36.6	38.5	36.6	36.6
Input power kW	0.14	0.46	0.89	1.32	1.73
Output power kW	0.11	0.37	0.75	1.11	1.47
Output torque Nm	29	98	186	291	384
<b>500 RPM INPUT</b>					
Output speed RPM	24.4	24.4	25.6	24.4	24.4
Input power kW	0.10	0.33	0.61	0.99	1.17
Output power kW	0.08	0.27	0.51	0.82	0.98
Output torque Nm	30	104	189	321	382
<b>250 RPM INPUT</b>					
Output speed RPM	12.2	12.2	12.8	12.2	12.2
Input power kW	0.05	0.17	0.31	0.51	0.60
Output power kW	0.04	0.13	0.25	0.41	0.48
Output torque Nm	30	103	187	318	379

## jPM Unit Ratings - Single Reduction

NOMINAL RATIO 25 TO 1



IMPORTANT

Units to ATEX approval must be selected with a minimum service factor of 1.25

DESCRIPTION	UNIT SIZE				
	11	17	22	26	30
<b>ACTUAL RATIO</b>	25:1	25:1	49:2	49:2	25:1
<b>1500 RPM INPUT</b>					
Output speed RPM	60.0	60.0	61.2	61.2	60.0
Input power kW	0.23	0.58	1.08	1.61	2.34
Output power kW	0.18	0.47	0.92	1.38	1.98
Output torque Nm	29	75	144	216	315
<b>1000 RPM INPUT</b>					
Output speed RPM	40.0	40.0	40.8	40.8	40.0
Input power kW	0.19	0.47	0.84	1.26	2.14
Output power kW	0.14	0.37	0.70	1.06	1.76
Output torque Nm	34	89	163	247	423
<b>750 RPM INPUT</b>					
Output speed RPM	30.0	30.0	30.6	30.6	30.0
Input power kW	0.15	0.41	0.68	1.05	1.99
Output power kW	0.11	0.32	0.56	0.87	1.61
Output torque Nm	37	100	174	271	513
<b>500 RPM INPUT</b>					
Output speed RPM	20.0	20.0	20.4	20.4	20.0
Input power kW	0.12	0.33	0.47	0.77	1.53
Output power kW	0.09	0.25	0.38	0.62	1.20
Output torque Nm	41	120	177	291	575
<b>250 RPM INPUT</b>					
Output speed RPM	10.0	10.0	10.2	10.2	10.0
Input power kW	0.073	0.21	0.24	0.40	0.95
Output power kW	0.055	0.15	0.19	0.31	0.73
Output torque Nm	48	142	175	289	686

**jPM Unit Ratings - Single Reduction**

NOMINAL RATIO 30 TO 1

**IMPORTANT**  
Units to ATEX approval must be selected with a minimum service factor of 1.25

DESCRIPTION	UNIT SIZE				
	11	17	22	26	30
ACTUAL RATIO	30:1	30:1	30:1	30:1	30:1
<b>1500 RPM INPUT</b>					
Output speed RPM	50.0	50.0	50.0	50.0	50.0
Input power kW	0.19	0.61	1.23	1.59	2.05
Output power kW	0.15	0.48	1.00	1.30	1.69
Output torque Nm	28	92	191	250	324
<b>1000 RPM INPUT</b>					
Output speed RPM	33.3	33.3	33.3	33.3	33.3
Input power kW	0.15	0.41	0.96	1.44	1.85
Output power kW	0.11	0.33	0.76	1.15	1.49
Output torque Nm	32	91	218	329	427
<b>750 RPM INPUT</b>					
Output speed RPM	25.0	25.0	25.0	25.0	25.0
Input power kW	0.13	0.36	0.80	1.19	1.66
Output power kW	0.09	0.27	0.62	0.93	1.30
Output torque Nm	35	103	237	356	498
<b>500 RPM INPUT</b>					
Output speed RPM	16.7	16.7	16.7	16.7	16.7
Input power kW	0.097	0.29	0.61	0.91	1.28
Output power kW	0.067	0.22	0.46	0.69	0.98
Output torque Nm	38	123	263	398	559
<b>250 RPM INPUT</b>					
Output speed RPM	8.3	8.3	8.3	8.3	8.3
Input power kW	0.059	0.18	0.37	0.57	0.80
Output power kW	0.039	0.13	0.27	0.41	0.58
Output torque Nm	45	144	305	473	663

## jPM Unit Ratings - Single Reduction

NOMINAL RATIO 40 TO 1



## IMPORTANT

Units to ATEX approval must be selected with a minimum service factor of 1.25

DESCRIPTION	UNIT SIZE				
	11	17	22	26	30
ACTUAL RATIO	40:1	40:1	40:1	40:1	40:1
<b>1500 RPM INPUT</b>					
Output speed RPM	37.5	37.5	37.5	37.5	37.5
Input power kW	0.14	0.41	0.84	1.25	1.63
Output power kW	0.10	0.31	0.65	0.97	1.26
Output torque Nm	25	78	166	248	324
<b>1000 RPM INPUT</b>					
Output speed RPM	25.0	25.0	25.0	25.0	25.0
Input power kW	0.11	0.33	0.65	0.97	1.33
Output power kW	0.07	0.24	0.49	0.73	1.00
Output torque Nm	28	92	186	281	381
<b>750 RPM INPUT</b>					
Output speed RPM	18.7	18.7	18.7	18.7	18.7
Input power kW	0.089	0.28	0.55	0.81	1.12
Output power kW	0.059	0.20	0.40	0.60	0.82
Output torque Nm	30	101	202	305	416
<b>500 RPM INPUT</b>					
Output speed RPM	12.5	12.5	12.5	12.5	12.5
Input power kW	0.068	0.22	0.42	0.62	0.86
Output power kW	0.044	0.15	0.29	0.44	0.61
Output torque Nm	33	112	224	340	464
<b>250 RPM INPUT</b>					
Output speed RPM	6.2	6.2	6.2	6.2	6.2
Input power kW	0.040	0.13	0.26	0.38	0.54
Output power kW	0.025	0.08	0.17	0.26	0.36
Output torque Nm	38	130	263	397	545

**jPM Unit Ratings - Single Reduction**

NOMINAL RATIO 50 TO 1



IMPORTANT

Units to ATEX approval must be selected with a minimum service factor of 1.25

DESCRIPTION	UNIT SIZE				
	11	17	22	26	30
<b>ACTUAL RATIO</b>	<b>50:1</b>	<b>50:1</b>	<b>50:1</b>	<b>50:1</b>	<b>50:1</b>
<b>1500 RPM INPUT</b>					
Output speed RPM	30.0	30.0	30.0	30.0	30.0
Input power kW	0.104	0.33	0.63	0.92	1.29
Output power kW	0.070	0.23	0.46	0.69	0.97
Output torque Nm	22	74	147	220	310
<b>1000 RPM INPUT</b>					
Output speed RPM	20.0	20.0	20.0	20.0	20.0
Input power kW	0.080	0.25	0.49	0.72	1.02
Output power kW	0.051	0.17	0.34	0.52	0.75
Output torque Nm	25	83	165	249	356
<b>750 RPM INPUT</b>					
Output speed RPM	15.0	15.0	15.0	15.0	15.0
Input power kW	0.067	0.21	0.41	0.60	0.85
Output power kW	0.042	0.14	0.28	0.42	0.60
Output torque Nm	27	89	179	270	384
<b>500 RPM INPUT</b>					
Output speed RPM	10.0	10.0	10.0	10.0	10.0
Input power kW	0.046	0.16	0.31	0.46	0.65
Output power kW	0.028	0.10	0.21	0.31	0.45
Output torque Nm	27	99	196	298	426
<b>250 RPM INPUT</b>					
Output speed RPM	5.0	5.0	5.0	5.0	5.0
Input power kW	0.025	0.09	0.19	0.29	0.41
Output power kW	0.015	0.05	0.12	0.18	0.26
Output torque Nm	28	105	223	349	500

## jPM Unit Ratings - Single Reduction

NOMINAL RATIO 60 TO 1

**IMPORTANT**  
Units to ATEX approval must be selected with a minimum service factor of 1.25

DESCRIPTION	UNIT SIZE				
	11	17	22	26	30
ACTUAL RATIO	60:1	60:1	60:1	60:1	60:1
<b>1500 RPM INPUT</b>					
Output speed RPM	25.0	25.0	25.0	25.0	25.0
Input power kW	0.086	0.26	0.49	0.72	1.01
Output power kW	0.055	0.18	0.34	0.52	0.74
Output torque Nm	21	68	131	197	283
<b>1000 RPM INPUT</b>					
Output speed RPM	16.7	16.7	16.7	16.7	16.7
Input power kW	0.066	0.20	0.39	0.57	0.80
Output power kW	0.041	0.13	0.26	0.39	0.56
Output torque Nm	23	76	148	225	324
<b>750 RPM INPUT</b>					
Output speed RPM	12.5	12.5	12.5	12.5	12.5
Input power kW	0.054	0.17	0.32	0.48	0.66
Output power kW	0.032	0.11	0.21	0.32	0.45
Output torque Nm	24	82	161	242	348
<b>500 RPM INPUT</b>					
Output speed RPM	8.3	8.3	8.3	8.3	8.3
Input power kW	0.039	0.13	0.24	0.36	0.50
Output power kW	0.022	0.08	0.15	0.23	0.33
Output torque Nm	25	90	175	265	381
<b>250 RPM INPUT</b>					
Output speed RPM	4.2	4.2	4.2	4.2	4.2
Input power kW	0.021	0.075	0.15	0.23	0.31
Output power kW	0.012	0.043	0.09	0.14	0.19
Output torque Nm	27	98	205	311	440

**jPM Unit Ratings - Single Reduction**

NOMINAL RATIO 70 TO 1

**IMPORTANT**  
Units to ATEX approval must be selected with a minimum service factor of 1.25

DESCRIPTION	UNIT SIZE				
	11	17	22	26	30
ACTUAL RATIO	70:1	70:1	70:1	70:1	70:1
<b>1500 RPM INPUT</b>					
Output speed RPM	21.4	21.4	21.4	21.4	21.4
Input power kW	0.070	0.23	0.43	0.63	0.85
Output power kW	0.040	0.15	0.28	0.43	0.59
Output torque Nm	18	65	127	191	262
<b>1000 RPM INPUT</b>					
Output speed RPM	14.3	14.3	14.3	14.3	14.3
Input power kW	0.049	0.17	0.33	0.49	0.70
Output power kW	0.028	0.10	0.21	0.32	0.46
Output torque Nm	19	71	142	215	307
<b>750 RPM INPUT</b>					
Output speed RPM	10.7	10.7	10.7	10.7	10.7
Input power kW	0.039	0.14	0.28	0.41	0.58
Output power kW	0.022	0.08	0.17	0.26	0.37
Output torque Nm	19	73	153	231	327
<b>500 RPM INPUT</b>					
Output speed RPM	7.1	7.1	7.1	7.1	7.1
Input power kW	0.027	0.099	0.20	0.31	0.45
Output power kW	0.015	0.056	0.12	0.19	0.27
Output torque Nm	20	75	160	254	363
<b>250 RPM INPUT</b>					
Output speed RPM	3.6	3.6	3.6	3.6	3.6
Input power kW	0.016	0.055	0.11	0.17	0.26
Output power kW	0.008	0.030	0.06	0.10	0.15
Output torque Nm	21	79	168	267	397

**RENOLD**

**Notes**

### ARGENTINA

Bennett Anderson,  
Gonzales Y Cia SA, J.Aguero 1817  
(1605) Munro  
Buenos Aires  
Tel: + 54 11 4761 5007 / 3531  
Fax: + 54 11 4760 0866

Los Ases Ketten SA,  
Avda Gaona 4046,  
1407 Buenos Aires  
Tel: + 54 11 6710855  
Fax: + 54 11 6713141

### AUSTRALIA

Renold Australia Proprietary Ltd  
508-520 Wellington Road,  
Mulgrave, Victoria 3170, Mulgrave  
North  
Tel: +61 (0) 3 9262 3333  
Fax: +61 (0) 3 9561 8561  
Branch Tel: +61 (0) 3 9262 3355  
Email: melcag@renold.com.au

Unit 1,  
12-18 Victoria Street, Lidcombe,  
Sydney, NSW 2141.  
Tel: +61 (0) 2 9649 3122  
Fax: +61 (0) 2 9646 1295  
Email: nswsales@renold.com.au

Unit 10,  
31 Boyland Avenue,  
Coopers Plains, Brisbane,  
Queensland 4108.  
Tel: +61 (0) 7 3275 2155  
Fax: +61 (0) 7 3875 1779

Corner Ormond & George Sts.  
Hindmarsh, Adelaide,  
South Australia 5007.  
Tel: +61 (0) 8 8346 9077  
Fax: +61 (0) 8 8340 1217

Unit 2,  
127 Grandstand Street, Belmont,  
Perth, West Australia 6104.  
Tel: +61 (0) 8 9479 1388  
Fax: +61 (0) 8 9479 1364

Unit 13  
56 Industrial Drive,  
Mayfield, NSW 2304  
Tel: +61 (0) 2 4960 8440  
Fax: +61 (0) 2 4960 8455

PO Box 159,  
Unanderra, Wollongong, NSW 2526.  
Tel: +61 (0) 2 42 621771  
Fax: +61 (0) 2 42 621772

Shop B,  
247 Ingham Road,  
Garbutt, Townsville, QLD 4814.  
Tel: +61 (0) 7 4779 5922  
Fax: +61 (0) 7 4775 1446

### AUSTRIA

Renold GmbH  
Rudolf Hausner Gasse 60/1  
A-1220 Wien  
Austria.  
Tel: +43 (0) 1 3303484 0  
Fax: +43 (0) 1 3303484 5

### BANGLADESH

Brady & Co (Bangladesh) Ltd,  
31, Bangabandhu Avenue,  
Dhaka-1000  
Tel: + 880 2802358  
Fax: + 880 2802358

### BELGIUM

Renold Continental Ltd  
Allée Verte 1,1000 Brussel.  
Tel: +32 (0) 2 2011262  
Fax: +32 (0) 2 2032210  
Email: info@renold.be

### CANADA

Renold Canada Ltd  
121 Roy Boulevard, Brantford,  
Ontario, N3T 5N4  
Toll Free: 1-800-265-9970  
Tel: +1 519 756 6118  
Fax: +1 519 756 1767  
Email: inquiry@renoldcanada.com

622 rue De Hull,  
Ville La Salle,  
Quebec, H8R 1V9.  
Toll Free: 1-800-361-1414  
Tel: +1 514 367 1764  
Fax: +1 514 367 4993

### CHILE

Sargent S.A.,  
Avda. Presidente Bulnes No 205,  
Casilla 166-D,  
Santiago - Chile.  
Tel: +(56 2) 510 3000  
Fax: +(56 2) 698 3989  
Email: secventas@sargentagrcola.cl

### CHINA

Renold Transmission (Shanghai)  
Company Limited  
Unit 4A, Block 15  
69 XiYa Road  
Waigaoqiao Free Trade Zone  
Shanghai 200131  
Tel: +86 21 5046 2696  
Fax: +86 21 5046 2695  
Email: sales@renold.cn

### COLOMBIA

Transmission de Potencia SA  
Carrera 68B No10 - 98  
Apartado Aereo 6794  
Santafe de Bogato DC  
Tel: +571 2600100  
Fax: +571 2904823

Importadora Casa Sueca Ltda.,  
Calle 52, No. 1N-74,  
Apartado Aereo 1208, Cali.  
Tel: 00 57 2346 4455  
Fax: 00 57 2346 4967

### CZECH REPUBLIC

Renold GesmbH  
Technical Office, Dipl. Ing. R.  
Badura,  
Jaroslavice 129, CZ-76001 Zlin.  
Tel: +42 67 7211074  
Fax: +42 67 7211074

### DENMARK

Renold A/S,  
Skelmarksvej 6, Postboks 90,  
2605 Brondby.  
Tel: +45 43 452611  
Fax: +45 43 456592  
Email: infor@renold.com

### EGYPT

Itaco,  
Int'l for Trading & Agency,  
P.O. Box 7550, Nasr City, Cairo.  
Tel: + 20 2 2718036  
Fax: + 20 2 2878089

### EL SALVADOR

MVA & Cia  
Residencial San Luis,  
Avenida 4 #45 Block 2,  
San Salvador,  
El-Salvador, Central America  
Tel: + 503 274 649

### FINLAND

Kraftmek Oy,  
Hitsaajaankatu 9, P.O. Box 36,  
FIN-00811 Helsinki  
Tel: + 358 9 7557355  
Fax: + 358 9 7550414

### FRANCE

Brampton Renold,  
Zone Industrielle A, Rue de la  
Pointe, BP 359, 59473 Seclin Cedex.  
Tel: +33 (0) 320 16 29 29  
Fax: +33 (0) 320 16 29 00

### GERMANY

Arnold & Stolzenberg,  
Juliusmühle,  
D37574 Einbeck.  
Postal address:  
PO Box 1635 + 1645  
D37557 Einbeck.  
Tel: +49 (0) 5562 81163  
Fax: +49 (0) 5562 81102  
Email: arnoldstolzenberg  
@t-online.de

### GREECE

Provatas Engineering  
53/47 Dragatsaniou St,  
185 - 45 Piraeus.  
Tel: +30 1 4170266  
Fax: +30 1 4170253

### HOLLAND

Renold Continental Ltd,  
Jarmuiden 30c,  
1046 AD Amsterdam.  
Tel: +31 (0) 20 614 6661  
Fax: +31 (0) 20 614 6391  
Email: info@renold.nl

### HUNGARY

Renold GesmbH  
Technical Office, Ing. Havasi Janos,  
Ret Utca 25, H-6200 Kiskörös.  
Tel: +36 (0) 78 312483  
Fax: +36 (0) 78 312484

### INDIA

Volta Limited.,  
Machine Tool Division,  
Volta House B, 3rd Floor,  
TB Kadam Marg,  
Chinchpokli,  
Mumbai 400033  
Tel: 091 22 370 0829  
Fax: 091 22 371 4889  
Email: mshaik@voltastd.com

### NORTHERN IRELAND

Henry R. Ayton Ltd,  
Derriagh, Dunmurry, Belfast.  
Tel: 01232 618511  
Fax: 01232 602436

### SOUTHERN IRELAND

Henry R. Ayton Ltd.,  
Broomhill Drive, Tallagh, Dublin 24  
Tel: + 353 (0) 1 4517922  
Fax: + 353 (0) 1 4517922

### ISRAEL

Technica J. Bokstein Co. Ltd,  
3 Hatrupa Street,  
Netanya 42504  
Tel: + 972 9 8850505  
Fax: + 972 36131074

### ITALY

Bianchi Cuscinetti SpA  
Via Zuretti, 102, 20125 Milano,  
Tel: + 39 02 67861  
Fax: + 39 02 66981669

### JAMAICA

Masterton Ltd,  
21-25 Hanover Street, P.O. Box 73  
Kingston.  
Tel: + 18 767 540557  
Fax: + 18 769 227807

### KOREA

S.S. Corporation,  
Yeouido, P.O. Box 60, Seoul.  
Tel: 00-822-783-6829  
Fax: 00-822-784-9322  
Email: ss corp@chollian.net

### MALAYSIA

Renold (Malaysia)  
LOT 2, Jalan Kecapi 33/2,  
Eilte Industrial Park,  
Off Jalan Bukit, Kemuning,  
40400 Shah Alam, Selangor,  
Malaysia.  
Tel: + 60 3 5122 9880  
Fax: + 60 3 5191 9881  
Email: malaysia@renold.com

201, Jalan Simbang,  
Taman Perling,  
81200 Joho Bharu, Johor, Malaysia.  
Tel: + 60 (0) 7 2384152-3  
Fax: + 60 (0) 7 2384155  
Email: malaysia@renold.com

67A, Jalan Medan Ipoh 6,  
Bandar Baru Medan,  
31400 Ipoh, Perak  
Tel: + 60 (0) 5 548 0059  
Fax: + 60 (0) 5 548 0214  
Email: malaysia@renold.com

28B Jalan Perai Jaya 3,  
Bandar Perai Jaya, 13600 Perai,  
Penang, Malaysia  
Tel: + 604-399 9648  
Tel: + 604-399 0648  
Fax: + 604-399 5649  
Email: malaysia@renold.com

### MAURITIUS

Dynamotors Ltd,  
P.O. Box 733, Bell Village,  
Tel: + 230 2122847/8/9  
Fax: + 230 2088348

### MEXICO

Accessories Automotrices y  
Rodamientos Industriales,  
S.A. de C.V., Calz Legaria 833-A  
Col Irrigacion, Mexico DF 11500  
Tel: + 52 5 395 6300  
Fax: + 52 5 395 6370

**RENOLD Worldwide Sales and Services****NEW ZEALAND**

**Renold New Zealand,**  
594 Rosebank Road,  
Avondale, Auckland.

**Postal Address:**  
PO Box 19460,  
Avondale, Auckland.  
**Tel:** + 64 (0) 9 828 5018  
**Fax:** + 64 (0) 9 828 5019  
**Email:** [aksales@renold.co.nz](mailto:aksales@renold.co.nz)

**Christchurch Branch Office,**  
32 Birmingham Drive, Christchurch,  
PO Box 9006, Christchurch,  
**Tel:** + 64 03 338 2169  
**Fax:** + 64 03 338 8663

**NORWAY**

**G. Heier A/S,**  
Postal Address: Postboks 6615,  
Rodelokka, 0502 Oslo, Norway.  
Office Address: Thv, Meyersgt.  
7, Oslo.  
**Tel:** + 47 232 34230  
**Fax:** + 47 232 34242

**PAKISTAN**

**Brady & Co. of Pakistan Ltd,**  
Shernaz House, P.O. Box 4453,  
West Wharf Road, Karachi 2.  
**Tel:** + 92 21.2310367/201712  
**Fax:** + 92 21.2313376/2313378

**PERU**

**Corporacion Basco S.A.C.**  
Av. Argentina 1165,  
Lima 1, RUC 25776186.  
**Tel:** + 51 1 4336633  
**Fax:** + 51 1 4313188

**PORTUGAL**

**Harker, Sumner, S.A.**  
Zona Industrial Maia 1 - Sector X  
4475 - 132 Gemunde - Maia  
Portugal.  
**Tel:** + 351 229 4478 090  
**Fax:** + 351 229 4478 098  
**E-mail:** [accionamentos.ind@harker.pt](mailto:accionamentos.ind@harker.pt)

**SINGAPORE**

**Renold Transmission Limited**  
63 Hillview Avenue, #07-13,  
Lam Soon Industrial Building,  
Singapore 669569.  
**Tel:** + 65 6760 2422  
**Fax:** + 65 6760 1507  
**E-mail:** [renold@mbox5.singnet.com.sg](mailto:renold@mbox5.singnet.com.sg)

**SOUTH AFRICA**

**Renold Croft (Pty) Limited,**  
Corner Liverpool and Bolton Streets,  
Nestadt Industrial Sites, Benoni, 1501  
Postal Address: Private Bag x 030,  
Benoni, 1500.  
**Tel:** + 27 (0) 11 747 9500  
**Fax:** + 27 (0) 11 747 9505  
**E-mail:** [renold@iafrica.com](mailto:renold@iafrica.com)

**P.O. Box 2661, Witbank 1035,**  
Mpumalanga,  
Republic of South Africa.  
**Tel:** +27 (0) 13 692 7760  
**Fax:** +27 (0) 13 697 0546  
**Email:** [renoldwit@worldonline.co.za](mailto:renoldwit@worldonline.co.za)

**SPAIN**

**Brown Pestell,**  
Ctra N-11 Lm. 599.5 Nave 5,  
08780 Palleja, Barcelona.  
**Tel:** + 34 93 6630740  
**Fax:** + 34 93 6632057

**SWEDEN**

**Renold A/S**  
Skelmarksvej 6, Postboks 90  
2605 Brøndby  
Denmark.  
**Tel:** + 45 43 452611  
**Fax:** + 45 43 456592  
**E-mail:** [infor@renold.com](mailto:infor@renold.com)

**SWITZERLAND**

**Renold (Switzerland) GmbH,**  
Ringstrasse 16, Postfach 1115  
CH-8600 Dübendorf 1.  
**Tel:** + 41 (0) 44 824 8484  
**Fax:** + 41 (0) 44 824 8411  
**E-mail:** [dubendorf@renold.com](mailto:dubendorf@renold.com)

**ROUTE DE PRILLY 25,**

CH-1023 Crissier.  
**Tel:** + 41 (0) 21 632 9460  
**Fax:** + 41 (0) 21 632 9475  
**E-mail:** [crissier@renold.com](mailto:crissier@renold.com)

**THAILAND**

**United Power Engineering Co Ltd**  
4 Soi Sukhumvit 81 (Siripot)  
Sukhumvit Road  
Bangjak, Phrakanong  
Bangkok 10260.  
**Tel:** + 66 2 7425366  
**Fax:** + 66 2 7425379

**TRINIDAD**

**Tracmac Engineering Ltd,**  
P.O. Box 945, Port of Spain,  
Trinidad, West Indies.  
**Tel:** + 1 665 460 1532  
**Fax:** + 1 868 671 0012

**TURKEY**

**Glengo İthalat İhracat Mumessillik AS,**  
Gungoren Cad. No. 35 Bagcilar,  
34560  
Bakirkoy, İstanbul.  
**Tel:** + 90 212 4613970  
**Fax:** + 90 212 4613972  
[www.glengo.com.tr](http://www.glengo.com.tr)

**UNITED KINGDOM**

**Renold Gears**  
Holroyd Gears Works, Milnrow,  
Rochdale OL16 3LS  
**Tel:** +44 (0) 1706 751000  
**Fax:** +44 (0) 1706 751001  
**E-mail:** [gears.sales@renold.com](mailto:gears.sales@renold.com)  
**Web:** [www.renold.com](http://www.renold.com)

**Renold Clutches & Couplings**

Wentloog Corporate Park,  
Newlands Road,  
Cardiff CF3 2EU, Wales  
**Tel:** + 44 (0) 29 20792737  
**Fax:** + 44 (0) 29 20793004  
**(Sales):**+ 44 (0) 29 20791360  
**E-mail:** [couplings@cc.renold.com](mailto:couplings@cc.renold.com)  
**Web:** [www.renold.com](http://www.renold.com)

**Renold Hi-Tec Couplings**

112 Parkinson Road  
Halifax HX1 3QH  
**Tel:** +44 (0) 1422 255000  
**Fax:** +44 (0) 1422 320273  
**E-mail:** [sales@hitec.renold.com](mailto:sales@hitec.renold.com)  
**Web:** [www.renold.com](http://www.renold.com)

**Renold Chain**

UK Sales, Horninglow Road,  
Burton upon Trent,  
Staffordshire, DE14 2PS.  
**Tel:** +44 (0) 1283 512 940  
**Fax:** +44 (0) 1283 512 628  
**E-mail:** [enquiry@renold.com](mailto:enquiry@renold.com)

**Terms and Conditions**

- In the interests of safety, customers are reminded that when purchasing any technical product for use at work (or otherwise), any additional or up-to-date information and guidance, which it has not been possible to include in the publication, should be obtained by you from your local sales office in relation to the suitability and the safe and proper use of the product. All relevant information and guidance must be passed on by you to the person engaged in, or likely to be affected by or responsible for the use of the product.
- The performance levels and tolerances of our product stated in this catalogue (including without limitation, serviceability, wearlife, resistance to fatigue, corrosion protection) have been verified in a programme of testing and quality control in accordance with Renold, independent and/or international standard recommendations. No representations or warranties are given that our product shall meet the stated performance levels or tolerances for any given application outside the performance levels and tolerances for the product's own specific application and environment.

- Whilst all reasonable care in compiling the information contained in this catalogue is taken, no responsibility is accepted for errors.
  - All information contained in this catalogue is subject to change without notice.
  - The illustrations used in this catalogue represent the type of product described but the goods supplied may vary in some detail from those illustrated.
  - The right is reserved to make modifications to the product to meet manufacturing conditions and/or developments (for example in design or materials).
  - Product can be supplied by Renold companies or representatives around the world on the standard terms and conditions of sale of the company or representative from which the product is purchased.
  - Copyright Renold Power Transmission Limited 2001. All rights reserved.
- Nothing contained in this publication shall constitute a part of any contract, express or implied.

**AUSTRALIA**

Melbourne (Victoria)  
Tel +61 (03) 9262 3333  
Fax +61 (03) 9561 8561  
also at: Sydney, Brisbane, Adelaide, Perth,  
Newcastle, Wollongong, Townsville.

**AUSTRIA**

Vienna  
Tel +43 (0) 13303484-0  
Fax +43 (0) 13303484-5  
also at: Kiskörös (Hungary), Jaroslavice  
(Czech Republic).

**BELGIUM**

Brussels  
Tel +32 (0) 2 201 1262  
Fax +32 (0) 2 203 2210

**CANADA**

Brantford (Ontario)  
Tel +1 519 756 6118  
Fax +1 519 756 1767  
also at: Montreal.

**CHINA**

Shanghai  
Tel +21 5046 2696  
Fax +21 5046 2695

**DENMARK**

Bröndby (Copenhagen)  
Tel +45 43 45 26 11  
Fax +45 43 45 65 92

**FRANCE**

Sedlin  
Tel +33 (0) 320 16 29 29  
Fax +33 (0) 320 16 29 00

**GERMANY**

Einbeck  
Tel +49 (0) 5562 81163  
Fax +49 (0) 5562 81102  
also at: Bielefeld, Düsseldorf,  
Kornwestheim.

**KOREA**

Seoul  
Tel +822 783 6829  
Fax +822 784 9322

**MALAYSIA**

Selangor Darul Ehsan  
Tel +60 3-5191 9880  
Fax +60 3-5191 9881  
also at: Johor Bharu, Ipoh, Penang.

**NETHERLANDS**

Amsterdam  
Tel +31 206 146661  
Fax +31 206 146391

**NEW ZEALAND**

Auckland  
Tel +64 9 828 5018  
Fax +64 9 828 5019  
also at: Christchurch.

**SINGAPORE**

Singapore  
Tel +65 6760 2422  
Fax +65 6760 1507

**SOUTH AFRICA**

Benoni  
Tel +27 11 747 9500  
Fax +27 11 747 9505  
also at: Witbank.

**SWEDEN**

Bröndby (Copenhagen)  
Tel +45 43 45 26 11  
Fax +45 43 45 65 92

**SWITZERLAND**

Dübendorf (Zürich)  
Tel +41 (0) 44 824 84 84  
Fax +41 (0) 44 824 84 11  
also at: Crissier (Lausanne).

**UK**

Renold Gears, Rochdale  
Tel +44 (0) 1706 751000  
Fax +44 (0) 1706 751001  
e-mail : gears.sales@renold.com

**USA**

Westfield NY  
Tel +1 716 326 3121  
Fax +1 716 326 6121

**WEB**

[www.renold.com](http://www.renold.com)

**E-MAIL**

e-mail : gears.sales@renold.com

For other country distributors  
please contact Renold UK.